



DC-10

Dual Counting Indicator Operation Manual (Full Version)



PLEASE READ THIS MANUAL VERY CAREFULLY BEFORE OPERATING THIS INSTRUMENT

Specifications subject to change without prior notice

Content

Cautions.....	9
1. Reminders	9
1.1 Metrological Legislation	9
1.2 Seal & Serial Number.....	9
1.3 Placing the Weighing Platform	9
1.4 Support & Service	9
2. Specifications.....	10
3. Panel and Keys.....	11
3.1 Key Board Description	12
3.2 Display Panel Description	14
4. Connection Points.....	15
4.1 Connection Pins & Plugs	15
4.2 P1 Load Cell Connector Pin Assignment Table	16
4.3 Relay Pin Assignment and Connection Table	16
4.4 RS232 Comports Pin Assignment for Uart0 and Uart2.....	16
5. Power Adaptor, Built-In Batteries and Recharging	17
5.1 Power Adaptor.....	17
5.2 Before Plugging in Power Adaptor to Electricity Grid.....	17
5.3 Before First Time Use	17
5.4 CR1220 Real Time Clock Backup Battery	17
5.5 Battery Voltage and Battery-Operation Application.....	17
5.6 Battery Lo.....	17
5.7 Battery Charging Status	17
6. Internal Function Settings.....	18
6.1 About Internal Function Table	18
6.2 How to Enter & Select Internal Function	18
6.3 Key Function during Internal Function Setting & Operation Mode	18
6.4 Shift between Platform #1 (P1) and Platform #2 (P2).....	18
6.5 Internal Function Table.....	19
7. Recommended Setting Procedures for User.....	26
8. UART & Comport Settings.....	27
8.1 UART Transmission Type & Assigned Comport No. Table	27
8.2 Parameters Table for PC & Command & Scanner.....	28
8.3 Parameters Table for Auto 1 ~ 3 & Manual	28
8.4 Android and iOS APP	29

8.4.1 Settings when Using App via WIFI Connection	29
8.4.2 Settings when Using App via Bluetooth Connection	30
9. Basic Operation	30
9.1 Power Instrument On and Off	30
9.2 Power on Countdown Process	30
9.3 Operator Code	30
9.4 Warm Up Time	31
9.5 Dual Platform Operation	31
9.5.1 Select preferred weighing platform by [PF/Set]	31
9.5.2 Summing up transaction results of both platforms	31
9.6 Keyboard Lock	31
9.7 Loads and Weighing Platform	31
9.8 Manual Zero	31
9.9 Tare Functions	31
9.9.1 Manual and automatic tare	31
9.9.2 Repetitive / multiple tare	32
9.9.3 Preset tare	32
9.10 Auto Power Saving & Auto Power off Time	32
9.11 Expiry Date	32
9.12 Print a Customer & Product Code Entered	32
9.13 Inputting Numbers, Letters, Symbols by Keyboard	32
10. Count Function	33
10.1 Obtain Unit Weight	33
10.1.1 Direct unit weight entry method	33
10.1.2 Sampling method	33
10.1.3 Employ the last unit weight when power on	34
10.1.4 Recall unit weigh unit from quick PLU	34
10.2 Start Counting Process	34
10.3 Auto Unit Weight Enhancement Function	34
10.4 Check Function	34
10.4.1 Check types and target	35
10.4.2 Hints for entering Lo and Hi limits	35
10.4.3 Cancel check function	35
10.4.4 Check Function priority rules for dual platform (PA) operation	35
10.4.5 Relay output	36
10.5 Memory Accumulation	36

10.5.1 Memory accumulation settings	36
10.5.2 Manual accumulation	36
10.5.3 Automatic accumulation	36
10.5.4 When data is accumulated to memory	36
10.5.5 Memory recall and clearance	37
10.5.6 Dual platform accumulation rules	37
11. Quick PLUs	38
11.1 Unit Weight Quick PLU.....	38
11.1.1 Create & save unit weight to quick PLU	38
11.1.2 Recall unit weight from quick PLU	38
11.1.3 Clear unit weight from quick PLU	38
11.2 Quantity Check Limit Quick PLU	38
11.2.1 Create & save quantity check limit to quick PLU	38
11.2.2 Recall quantity check limit from quick PLU	39
11.2.3 Clear quantity check limit from quick PLU	39
11.3 Weight Check Limit Quick PLU	39
11.3.1 Create & save weight check limit to quick PLU	39
11.3.2 Recall weight check limit from quick PLU	39
11.3.3 Clear weight check limit from quick PLU	39
11.4 Preset Tare Value Quick PLU	39
11.4.1 Create & save preset tare value to quick PLU	39
11.4.2 Recall preset tare value from quick PLU	40
11.4.3 Clear preset tare value from quick PLU	40
11.5 Product Code and Product Description	40
11.5.1 Create & save product code and product description to quick PLU	40
11.5.2 Recall product code and product description from quick PLU	40
11.5.3 Clear product code and product description from quick PLU	40
11.5.4 Applying blank product code and product description	41
11.6 Customer Code and Customer Description	41
11.6.1 Create & save customer code and customer description to quick PLU	41
11.6.2 Recall customer code and customer description from quick PLU	41
11.6.3 Clear customer code and customer description from quick PLU	41
11.6.4 Applying blank customer code and customer description	41
12. Customized Setting PLUs for Operation Settings & Parameters	42
12.1 Save Current Operation Settings/Parameters to Customized Setting PLU	42
12.2 Recall Operation Settings/Parameters from Customized Setting PLU	42

12.2.1 By Instrument keyboard	42
12.2.2 By Execution Command	43
12.3 Clear Customized Setting PLU	43
12.3.1 By Instrument keyboard	43
12.3.2 By Execution Command	43
12.4 Quit Current Customized Setting PLU Effect	43
13. Data Output Protocols & Formats	43
13.1 PC Output Protocols	43
13.2 Data & Print Formats	43
13.2.1 Predefined Output Formats	43
13.2.2 Lab 2 Customized Output Format	44
13.2.3 Label Printing	44
14. Alibi Transaction Memory & Management Report	44
14.1 Alibi Memory Description	44
14.2 Define when a Transaction Data is saved to Alibi memory	45
14.3 Output and Settings for Alibi Memory & Management Report	46
14.4 Totalization	46
15. Barcode Scanner	46
15.1 Using Barcode Scanner to Simulate Operation Key Input	46
15.2 Inputting Customer & Product Code and Operator Number.	46
15.2 Change to Different Input Target	47
15.3 More about Customer / Product Code & Description	47
16. Commands	47
17. System Message & Error Code	48
17.1 System Message Table	48
17.2 Error Code Table	48
18. Daily Care & Maintenance	49
Appendix A: - Pre-Defined PC Output Protocols	50
A.1 Data Abbreviation Table	50
A.2 Output Formats Tables	51
Appendix B: - Customized PC Output Protocol	53
B.1 Customized PC Output Protocol Setting Procedures	53
B.2 Customized PC Output Content Table	54
Appendix C: - Lab 1 Output Formats	56
Appendix D: - Standard Lab 2 Output Format	57
Appendix E: - Customized Lab 2 Output Format	58

E.1 Customized Lab 2 Output Format Variants Table	58
E.2 Edit Customized Lab 2 Print Output Format	59
Appendix F: - Lab 3 Output Formats	60
Appendix G: - Lab 4 Output Format	61
Appendix H: - Lab 5 Output Format	62
Appendix I: - TSC Printer Installation, Setup & Label Upload Procedures	63
I.1 Get the below ready before Printer Installation	63
I.2 Printer Installation	63
I.3 Uploading TCF File to Printer	63
I.4 Create & Upload Label to TSC Printer	64
I.4.1 Selecting the Correct Edition for Bartender Software	64
I.4.2 Adding Information from Instrument to Label & Uploading to a TSC Printer	64
Appendix J: - Sbarco Printer Installation, Setup & Label Upload Procedures	66
J.1 Get the below ready before Printer Installation	66
J.2 BarDrawer Software & Printer Driver Installation	66
J.3 Create & Upload Label to Sbarco Printer	67
Appendix K: - Label Programming, Illustration & Samples	69
K.1 Label Prompt Command Table	69
K2. Label programming Illustration	71
K.2.1 Label Illustration for LP50 & TSC	71
K.2.2 Label Illustration for Sbarco	71
K.3 Sample Labels	71
K.4 Quick Access to Label Settings	72
K.5 Repetitive Printout	72
Appendix L: - Keyboard Command	73
Appendix M: - Execution Commands	74
M.1 Command Description Table (System Related)	74
M.2 Command Description Table (Report Related)	75
M.3 Command Description Table (Customized Setting PLU Related)	75
Appendix N: - System Parameter & Operation Entry Setting Commands	76
Appendix O: - System Parameter Reading Commands	80
Appendix P: - Operation Entry Reading Commands	83
Appendix Q: - Operation Result Reading Commands	85
Appendix R: - Quick PLU Saving Commands	88
Appendix S: - Quick PLU Reading Commands	90
Appendix T: - Customized Operation Settings PLU Saving Commands	92

T.1 Command Description Table	92
T.2 Parameter Description Table	93
Appendix U: Customized Operation Settings PLU Reading Commands	95
U.1 Command Description Table	95
U.2 Parameter Output Description Table	96

Cautions

- The instrument is not an explosion proof device.
- The instrument is not a water proof device.
- Do not open the instrument, no user serviceable parts inside. Always contact your dealer for service.
- Do not place this instrument in where shock, excessive vibration or extremes of temperature (before or after installation) exist.

1. Reminders

1.1 Metrological Legislation

Because of metrological legislation, some metrological parameter settings are limited to be done by authorized personnel only. Do not attempt to change any parameters under internal function number F39 ~ F99. Contact your dealer for installation and technical assistance.

1.2 Seal & Serial Number

This instrument is legal for trade only when it is sealed (and/or stamped) and bearing a serial number. Do not attempt to break the seal (or stamp) or serial number affixed to this instrument. No warranty service will be provided if the seal (or stamp) or data plate affixed to this instrument is damaged or removed. Always contact your dealer for after sales service.

1.3 Placing the Weighing Platform

In order to obtain an accurate weighing result, the weighing platform must be placed on a strong and level surface. Avoid using this instrument and the weighing platform in any environment where excessive wind flow, vibration and extreme temperature change exist.

1.4 Support & Service



Always contact your dealer for product information, after sales service and questions when in doubt.

2. Specifications

Description	Platform #1 (P1)	Platform #2 (P2, Optional)
Capacity & Readability	Free Setting	Free Setting
Weighing Range	Single Range, Dual Range, Dual Interval	Single Range, Dual Range, Dual Interval
Weight Units	kg, g	kg, g
Displays	- Display #1: - 6 x 36mm LCD Numeric Digits - Display #2: - 6 x 17mm LCD Numeric Digits - Display #3: - 6 x 17mm LCD Numeric Digits	
Load Cell Connection	- Excitation Voltage = 5V DC - Support both 4-wire & 6-wire Load Cells - Maximum Load Cell Connection = 10 x 350Ω or 20 x 700Ω Load Cells - Maximum Load Cell Rated Output 4mV/V	- Excitation Voltage = 5V DC - Support both 4-wire & 6-wire Load Cells - Maximum Load Cell Connection = 10 x 350Ω or 20 x 700Ω Load Cells - Maximum Load Cell Rated Output 4mV/V
A/D Converter & Internal Resolution	24 bit Low-Noise Delta to Sigma ($\Delta-\Sigma$) 3.200,000 Counts at 15 mV - Minimum input per d = 0.05μV	24 bit Low-Noise Delta to Sigma ($\Delta-\Sigma$) 3.200,000 Counts at 15 mV - Minimum input per d = 0.05μV
AD Conversion Speed	15, 30, 60, 120 times/second Selectable	
Max. Tare Range	-Max for Single Range -Max₁ (Subtractive Tare) for Range / Interval	-Max for Single Range -Max₁ (Subtractive Tare) for Range / Interval
Calibration Methods	2 Span Points Calibration (Linearity Calibration) 1 Span Point Calibration - Numeric Calibration	2 Span Points Calibration (Linearity Calibration) 1 Span Point Calibration - Numeric Calibration
Power Source	- Built-in Rechargeable Battery = 6V, 4AH - External Power Adaptor = DC 12V, 1A	
Accessories	Pillar Mount Holder (φ35~38mm), Built-in Rechargeable Battery, Universal Power Adaptor, Dust Cover	
Packing	- Individually Packed. Dimensions = 36 x 32 x 16cm. Net / Gross = 2.35 / 2.85kg 6 Units in Shipping Carton. Dimensions = 102 x 35 x 35cm. Net / Gross = 17.00/ 18.50kg	
Operation Environment	-10 ~ 40°C. Non-condensed. R.H. ≤ 85%	

In the interest of improvement, specifications may change prior to notice

3. Panel and Keys

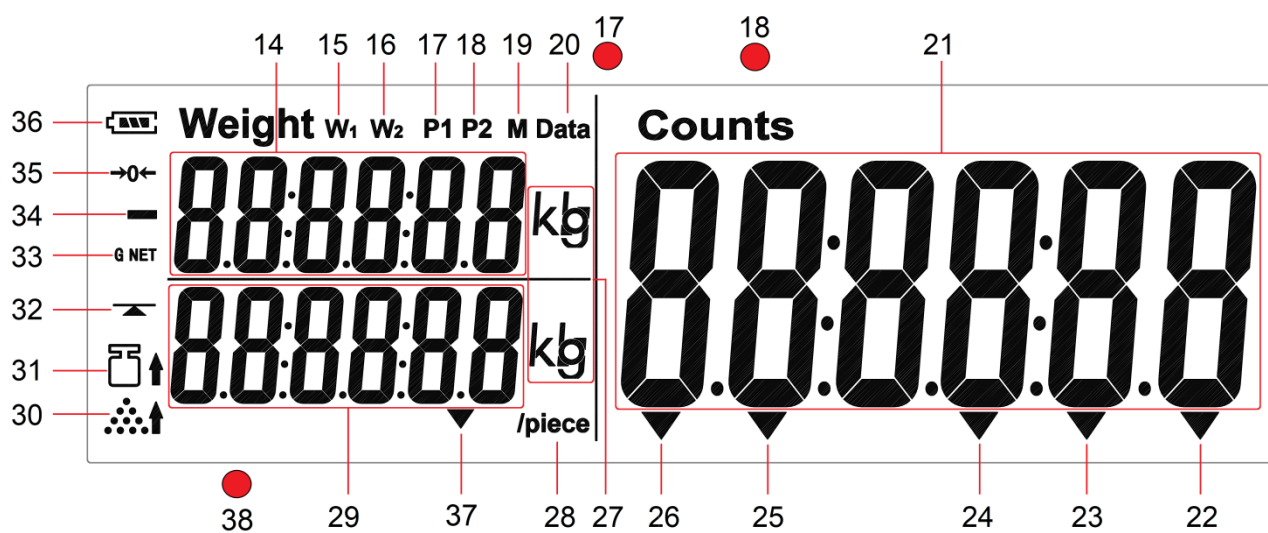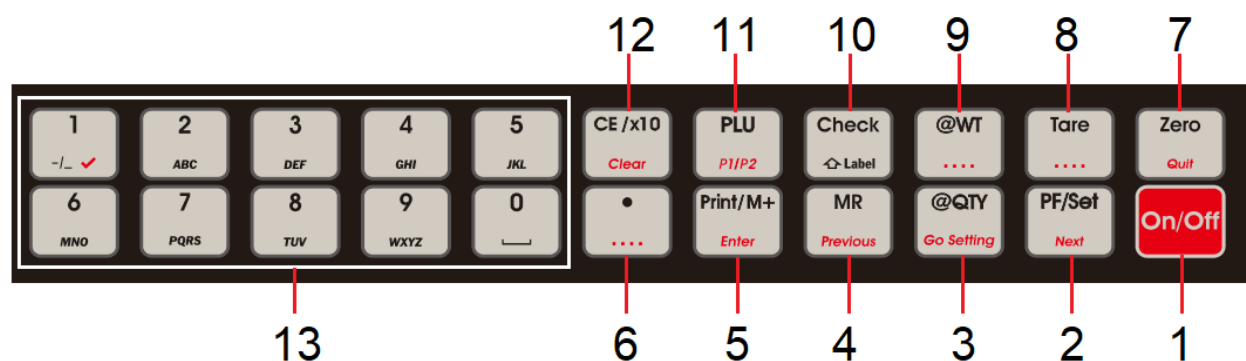

3.1 Key Board Description

No.	Description	Function Description	
		Normal Operation	Internal Function Setting
1	[On/Off]	Power instrument on or off.	Quit without saving and power off.
2	[PF/Set]	- When F31 = P.F.: - Shift among P1, P2 and P1+P2. - When F31 = Set: - Access internal function setting mode (F1~F36).	Go to next parameter or next internal function number.
3	[@QTY]	- Numeric value + [@QTY] = To introduce the numeric value being displayed on LCD3 as sample quantity. [@QTY] + [Check] = Start inputting Lo and Hi limit in terms of quantity.	Enter internal function during power on countdown process.
4	[MR]	Recall total stored transactions.	Go to previous parameter or previous internal function number.
5	[Print/M+]	Send print data out and/or accumulate current value to memory.	Enter, save and return.
6	[.]	Decimal.	Decimal.
7	[Zero]	Set weight displayed to zero when unloaded.	Quit without saving.
8	[Tare]	To tare off the weight of a container.	Nil.
9	[@WT]	- Numeric value + [@WT] = To introduce the numeric value being displayed on LCD3 as unit weight. - Short press = To save current unit weight to quick PLU. - Long press = To recall a unit weight from quick PLU. [@WT] + [Check] = Start inputting Lo and Hi limit in terms of weight.	Nil.

10	[Check]	- Short press = Starting inputting Lo and Hi limit under current checking condition (in terms of weight or quantity). - Long press = To recall Lo and Hi limit from quick PLU.	Quick access to label settings.
11	[PLU]	- Save current operation parameters to Customized Setting PLU. - Recall operation parameter from Customized Setting PLU.	To shift between P1 and P2.
12	[CE/x10]	- Clear value entered during setting process, or - Trigger the extended display mode.	Clear.
13	[0] ~ [9]	Numeric keys.	- Numeric, letters and symbol keys. - Press [0] to go to F1. - Press [1] to go to F10. - Press [9] to go to F90.

3.2 Display Panel Description


No.	Name	Description
14	LCD2	LCD display panel #2. Weight value is displayed here.
15	Max ₁ Indicator ¹	(When under dual weighing range/interval mode) Visible when this instrument is operating at the first weighing range (W ₁).
16	Max ₂ Indicator ²	(When under dual weighing range/interval mode) Visible when this instrument is operating in the second weighing range (W ₂).
17	P1 Indicator	(When under dual platform configuration) Visible when current / accumulated results of P1 is being displayed.
18	P2 Indicator	(When under dual platform configuration) Visible when current / accumulated results of P2 is being displayed.
19	M+ Indicator	Visible when memory contains of accumulated data.
20	Pre-Tare Indicator	Visible when a preset-tare value is in effect.
21	LCD1	LCD display panel #1. Number of pieces is displayed here.
22	Alibi Indicator	Flash when a transaction record is sent to alibi memory (Alibi memory)
23	Reserved	
24	Customized Setting Indicator	Visible when instrument is running under customized settings.
25	Qty Check Indicator	Visible when current Hi/Lo check function is in terms of quantity.
26	Weight Check Indicator	Visible when current Hi/Lo check function is in terms of weight.
27	Weight Unit Indicator	- kg = kilogram - g = gram
28	Unit Weight Indicator	Visible when unit weight value is being shown on LCD3.
29	LCD3	LCD display panel #3. Unit weight and value being edited is displayed here.
30	Unit Weight Lo Indicator	Visible when unit weight entered is less than 1/10d or d ₁ .
31	Sample Weight Lo Indicator	Visible when calculated unit weight of sample quantity entered is less than 1/10d or d ₁ .
32	Stable Indicator	Visible when weight value is stable.
33	Gross/Net Indicators	G: - Visible when gross result is being displayed. Net: - Visible when net result is being displayed.
34	Minus Indicator	Visible when a negative value is displayed.
35	Zero Indicator	Visible when instrument is at zero status.
36	Battery Level Indicator	Visible to show remaining battery of the built-in rechargeable battery.

1 (For Dual Range Mode) Visible when weighing range is = W₁.

2 (For Dual Range Mode) Visible when weighing range is = W₂.

37	Lower Case Indicator	Visible when lower case letter entry is in effect.
38	Charge Status Indicator	- Red color: Recharging battery, - Green color: Charging completed.

4. Connection Points

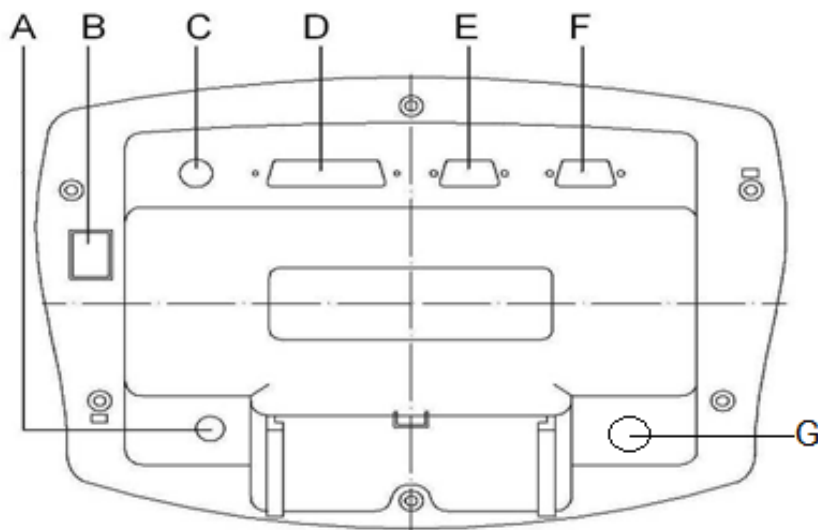

4.1 Connection Pins & Plugs

No.	Name	Description
A	DC Jack Input for Indicator	External power adaptor (DC12V, 1A center positive) is plugged in here. Do not plug in any other power adaptor than the one which comes with this instrument.
B	Reserved	
C	P1 Load Cell Connector (7-Pin)	Refer to below 4.2 P1 Load Cell Connector Pin Assignment Table for details.
D	Control Output Port	Refer to below 4.3 Relay Pin Assignment and Connection Table for details.
E	Comport 2 (UART 2 RS232)	Refer to below 4.4 RS232 Comports Pin Assignment for Uart0 and Uart2 for details.
F	Comport 0 (UART 0 RS232)	
G	P2 Load Cell Cable Gland	Load cell cable of P2 is thread through here.

4.2 P1 Load Cell Connector Pin Assignment Table

Pin #	Pin Assignment	Notes
1	Excitation +ve	- Apply both the 4/6 wire load cell jumpers on mainboard when 4-wire load cell is used. - Remove both the 4/6 wire load cell jumpers from mainboard when 6-wire load cell is used.
2	Remote Sense +ve	
3	Excitation -ve	
4	Remote Sense -ve	
5	Signal +ve	
6	Signal -ve	
7	Ground	

4.3 Relay Pin Assignment and Connection Table

Pin# on DB 25 Control Output Port	Relay Pin#	Remarks
1	Relay 4, Normal Open	Synchronized with HI Output
2	Relay 4, Common	
3	Relay 4, Normal Close	
4	Relay 3, Normal Open	Synchronized with OK Output
5	Relay 3, Common	
6	Relay 3, Normal Close	
8	Relay 2, Normal Open	Synchronized with LO Output
9	Relay 2, Common	
10	Relay 2, Normal Close	
11	Relay 1, Normal Open	Synchronized with Buzzar Output
12	Relay 1, Common	
13	Relay 1, Normal Close	

Notes: -

- In case control output is used, always plug in the power adaptor which comes with this instrument. Otherwise, no output signal will be sent.
- Common of a particular output is independent to the common of other control outputs.
- Dry contacts only.

4.4 RS232 Comports Pin Assignment for Uart0 and Uart2

Comport 0 (male)	Comport 2 (female)
2 = RXD	2 = TXD
3 = TXD	3 = RXD
5 = GND	5 = GND
9 = DC 5V Output	Nil

5. Power Adaptor, Built-In Batteries and Recharging

5.1 Power Adaptor

Always use the power adaptor supplied together with this instrument to avoid un-recoverable damages to this instrument.

5.2 Before Plugging in Power Adaptor to Electricity Grid

Double check if the input voltage marked on adaptor data matches with the electricity grid. If not, do not plug in and contact your dealer immediately.

5.3 Before First Time Use

To ensure the best battery performance, plug in the power adaptor to recharge the built-in battery for at least 8 hours before power on instrument.

5.4 CR1220 Real Time Clock Backup Battery

A CR1220 battery is installed to back up the real time clock of the system and other application parameters. Replace this battery with new one every 12 months for best performance. Contact your dealer for details and supports.

5.5 Battery Voltage and Battery-Operation Application

Battery voltage is displayed during power on countdown process on LCD1 and also by means of internal function F2.

Battery voltage below 6.0 is considered to be low and is not recommended for any battery-operated application which lasts for longer than 60 minutes (depends on actual system configuration).

5.6 Battery Lo

When **Lo.Bat message** appears on LCD1, battery level is low. Apply power adaptor to recharge battery immediately otherwise instrument will power off automatically shortly.

To protect the built-in rechargeable battery, this instrument will be powered off automatically when battery is at extremely low level. If this is the case, do not attempt to power this instrument on. Recharge this instrument immediately. Fail to do so may cause unrecoverable damages to the built-in rechargeable battery.

5.7 Battery Charging Status

Battery charging status is shown on the dual color **Charge Status Indicator**: -

- Red: - Recharging in process,
- Green: - Charging completed.

6. Internal Function Settings

6.1 About Internal Function Table

To enable this instrument to meet and to give the best performance under various application requirements and demands, a set of internal functions are built-in.

Most internal function comes with various parameters which user can select according to actual application demands and preference.

These internal functions are classified into 2 categories: -

- User accessible functions (F1 ~ F36 of below table), which do not request any password to access.
- Other internal functions are not for access to end users and may need password to access. **Do not attempt to access or alter any parameters without authorization to avoid system malfunction.**

6.2 How to Enter & Select Internal Function³

Depends on F31 settings: -

- a. If F31 is = P.F.: - Power off instrument and power on again. During countdown process, press **[@QTY]**.
 - b. If F31 is = Set: - Press **[PF/Set]** during normal operation status.
1. Instrument displays F1 and is now in internal function mode.
 2. Press **[PF/Set]** and **[MR]** to access the preferred internal function number.
 3. Quick access to a function number: -
 - a. Press **[0]** to go to F1.
 - b. Press **[1]** to go to F10.
 - c. Press **[2]** to go to F20.
 - d. Press **[3]** to go to F30.

6.3 Key Function during Internal Function Setting & Operation Mode

Refer to **paragraph 3.1** for more information.

6.4 Shift between Platform #1 (P1) and Platform #2 (P2)

Some internal functions are platform sensitive and it is possible to have different settings for P1 and P2 under the same internal function number.

For those platform sensitive internal function numbers, the current platform # is displayed on LCD3 before the internal number. To shift to another platform number, press **[PLU]**.

³ To fulfil the metrology law of certain countries, accessing to internal function by [Set] may be disabled. Contact your dealer for more information.

6.5 Internal Function Table

No.	Description	Parameters / Note Default = **						
F1	Internal Analogue to Digital (AD) Value	Press [Print/M+] to set offset value to zero when unloaded. Then add load on the platform to observe the span value of load applied. - LCD2 represents the million digits of the AD value. - LCD3 represents the AD value up to 999,999. For example: - - LCD2 displays 1 - LCD3 displays 083690 Then the actual AD value is 1,083,690. Press [Zero] to quit to F1.						
F2	All Segment Check & Battery Voltage	All display segments and indicators will be lit on. Check any segments or indicators are missing. Press [Zero] to quit to F2 or [Check] to show current battery voltage.						
F3	Capacity, Division & Default Weight Unit	Display basic metrology characteristics (capacity, division, and weight unit). - Capacity x Division of MAX₁ is shown on LCD2. Value displayed = Max₁ + d₁. - Capacity x Division of W₂ (if set) is shown on LCD3. Value displayed = Max₂ + d₂.						
F4	Date Format & Date	DD/MM/YY	** YY/MM/DD			MM/DD/YY		
	- Press [MR] or [PF/Set] to change date format and press [Print/M+] to confirm. - Then press [Print/M+] to check current date value. - To change date value, press [Print/M+] then enter date value and then press [Print/M+] to confirm. - Instrument will then convert and display the month and date value entered into week and day number (0 ~ 6 for Sunday ~ Saturday) of the year value entered. - Select Date Output Type: - 2 parameters are available: - ➤ Date = Normal date format as per input above. ➤ Week = WWYYDD format. WW = week number; YY = year value; DD = weekday (Monday = 01... Sunday = 07). - Press [MR] or [PF/Set] to select Date Output Type and press [Print/M+] to confirm.							
F5	Time	HH/MM/SS						
	To change time, press [Print/M+] , then enter a new value and press [Print/M+] .							
F6	System (F7~F36) Initialization	** NO			YES			
	- Press [PF/Set] to shift between NO and YES and press [Print/M+] to confirm. - If YES is selected, press [1] when “SURE?” is displayed. Instrument shows Done when initialization is completed.							
F7	Auto Power Off	Off	1	3	** 5	10	20	Other

	Setting									
	Notes: - - Off = Auto power off disabled. 1 ~ 20 = Auto power off after this idle time (minute). - Other = Set specific auto power off time. - Auto Power off time parameter 1 ~ 20 will be ignored when instrument is powered by power adaptor. To enter a specific auto power off time: - - select Other and press [Print/M+], - Enter the specific power off time in the format of HH.MM.SS then press [Print/M+] to save.									
	Auto power off function will be disabled when an energized power adaptor is plugged in.									
F8	Brightness	Brightness (01 ~ 99) ** Default = 60				Color Ratio (01 ~ 99) ** Default = 50				
	- To change setting, enter value through numeric keys and then press [Print/M+]. - Set brightness (bt) first, then set color ratio. Color ratio is used to generate the preferred yellow color. When instrument is powered by built-in rechargeable battery, backlight will be turned to minimum when battery is low or when weight value remains unchanged for 5 seconds.									
F9	Enable Totalization of P1 & P2	** Off (Disabled)				On (Enabled)				
	Notes: - - Select On to enable results totalization of 2 platforms. - When F79 is set to Off, this function is always = Off and this internal function is not accessible.									
F10	Filter Strength	1	2	3	4	** 5	6	7	8	9
	Press [MR] or [PF/Set] to select: - 1 (strongest filter) for bad working environment where vibration, wind flow... etc. affect stable reading, 5 for normal environment, 9 (least filter) for very good working environment where wind and vibration have no effect to stable reading. - Then press [Zero] to quit or [Print/M+] to save and continue with AD conversion speed setting. 5 AD conversion speed parameters (15 ~ 120 time per second) are available. Press [PF/Set] or [MR] to select: - ** 15 times per second. 30 times per second. Recommended maximum resolution = 30,000 division 60 times per second. Recommended maximum resolution = 15,000 division 120 times per second. Recommended maximum resolution = 7,500 division Note: - After the AD conversion speed is changed, instrument will restart automatically.									

F12	Auto Tare Function	** Off		On	Contin	
	Notes: - • Off = Auto Tare Function disable. • On = Only the first table weight applied will be tared off. Minimum tare load ≥ 2d. • Contin = All stable weight applied will be tared off. Minimum tare load ≥ 20d. • If Contin is set, select also delay time (0.0 ~ 9.9 second). Delay time is the time duration from a stable weight is detected and until it is automatically tare off. • Delay time value is displayed on LCD3. Enter the preferred delay time value through numeric keys and then press [Print/M+] to save.					
F13	Repetitive Tare Function	Off		** On		
	If F12 is set = Contin, Repetitive Tare setting “Off” will be surpassed.					
F14	Operation Buzzer	Kb (keypad buzzer) (**On/Off)		St (System buzzer) (**On/Off)		
F15	Check Buzzer & Action on Negative Value	oFF	** in	out	Hi	Lo
	• oFF = Check Buzzer disabled. • in = Check Buzzer activates when reading is within range. • out = Check Buzzer activates when reading is out of range. • Hi = Check Buzzer activates when reading more than Hi limit. • Lo = Check Buzzer activates when reading lower than Lo limit. Action on Negative Value • Off = Check Mode Disable when value is less than zero. • ** On = Absolute value, all negative values will be deemed and checked as positive ones.					
F16	UART (Comport) Setting	4 UARTs (UART 0, 1, 2, 3) are available. Refer to paragraph 8 for more setting details.				
F18	Machine ID and Group Number	Machine ID		Group Number		
	Notes: - a. Machine ID number entered is also used as the address number of the instrument for RS485 communication. b. When machine ID is = blank. It means that this instrument does not have any address number in the RS485 network. c. In multi-instrument application with the same RS485 network, each machine should have a unique machine ID number. d. Group number can be considered as production line number in multi-instrument application. e. The machine ID and group number entered will be carried out automatically on output formats Lab 2 ~ Lab 5. Setting procedures: - 1. Go to F18 and then press [Print/M+].					

	2. Set Machine ID number (00 ~ 98) then press [Print/M+]. To clear machine ID number, press [CE/x10] then press [Print/M+] to save. 3. Set group number (00 ~ 99) then press [Print/M+]. To clear group number, press [CE/x10] then press [Print/M+] to save and return to F18.		
F19	Manual Entry for Customer / Product Code & Description	P Code Product Code & Description	C Code Customer Code & Description

	- No: - Instrument will not ask for operation number when instrument power on. Notes: - - If a different operator number (than what is running now) is entered, instrument displays Clear. - The operator number entered will be carried out automatically on output formats Lab 3 ~ Lab 5.		
F29	Read Calibration & Parameter Counts and Pointer Value - C (Calibration count): - shows total times of calibration. - O (Parameter set count): - shows total times that the important parameters (F80~F88) has been altered. Press [Zero] to quit to F29 or [Check] to display the current pointer value. Pointer Value is the system serial number of the next transaction to be saved to Alibi memory.		
F30	Allow Letters and Symbols for Customer & Product Code Manual Entry	** No	Yes
F31	[PF/Set] Key Assignment	** Set (Access to Internal Function Setting when in Operation Status)	P.F. (Shift between P1 and P2)
	Note: - When F79 is set to Off , Mode Key is always = Set and this internal function is not accessible.		
F32	External Input Assignment	in1 (Input 1)	in2 (Input 2)
	in3 (Input 3)		
	1 of the below 7 input parameters can be assigned to each external input. - ZEro = [Zero] - tAre = [Tare] - Print = [Print/M+] - ACC-Mr = [MR] - CLEAR = [CE/x10] - P.F.= Shift among P1, P2 and PA. - Set = Access internal function setting mode (F1~F36). Setting procedures: - - Go to F32 then press [Print/M+]. - Name of the current external input No. is displayed on LCD2. - Press [MR] or [PF/Set] until the preferred external input point No. appears on LCD2 then press [Print/M+]. - Press [MR] or [PF/Set] until the preferred input parameter appears on LCD3 then press [Print/M+] to save - Instrument displays the next external input point No. on LCD2. - Repeat above steps 2 ~ 5 for all other external input points.		
F33	Report Output Comport & Content Settings	Set report output comport No. and report content setting	

Setting procedures: -

1. Go to F33 then press **[Print/M+]**.
2. Name of the report output port is displayed on LCD2.
Note: - avoid assigning RS485 for report output unless Machine ID (set in F18) is = blank.
3. Press **[MR]** or **[PF/Set]** until the preferred report output port appears on LCD2 then press **[Print/M+]**.
4. Instrument displays report content detail setting and parameter on LCD2 and LCD3 respectively. At this point, report output comport No. is set. Press **[Zero]** to quit to F33 or continue with below to set preferred report content detail parameters.
5. Press **[MR]** or **[PF/Set]** until the preferred report content detail parameter appears on LCD3 then press **[Print/M+]**.

Notes: -

3 report content detail parameters (Off, All and Custom) are available: -

- If Off is selected, instrument returns to F33. In this case, output report contents only the following data.
 - Alibi Transaction Memory Serial No.,
 - Date of the individual transaction,
 - Net Weight of the individual transaction,
 - Tare weight of individual transaction,
 - Gross weight of individual transaction.
 - If All is selected, instrument returns to F33. In this case, all contents will be outputted.
 - If Custom is selected, follow the below procedures for report content detail settings.
6. Press **[MR]** or **[PF/Set]** until the preferred report content detail parameter appears on LCD3 then press **[Print/M+]**. Below parameters are available.
 - oP.Code (Operator No.)
 - P.F. (Platform #)
 - id (Machine ID)
 - Group (Machine Group No.)
 - Time (Time of the individual transaction)
 - C Code (Customer Code)
 - C_dESC (Customer Description)
 - P Code (Product Code)
 - P_dESC (Product Description)
 - qty (No. of pieces)
 - Ref (Lo and Hi limit value of the individual transaction)
 - Result (Check result of the individual)
 - Title
 - Header
 - Footer
 7. Press **[PF/Set]** until the preferred parameter (On / Off) appears on LCD3 then press **[Print/M+]** to save and go to next report content detail parameter setting.
 8. Repeat above steps **6** and **7** to set all other report content detail until instrument returns to F33. At this point, report content detail setting is completed.

Refer to paragraph **14** for more information.

F34	Report Output / Search Criteria & Date Range	oP.Code (On/** Off)	C Code (On/** Off)	P Code (On/** Off)	Check (On/** Off)
	- oP.Code = Operator Code. - C Code = Customer Code - P Code = Product Code - Check = Check Result Setting Procedures: - - Go to F34 then press [Print/M+]. - Name of the 1st search criteria name is displayed on LCD2. - Press [MR] or [PF/Set] until the preferred search criteria appears on LCD3 then press [Print/M+]. Notes: - - Select On to enable that search criteria. - Select Off to disable that search criteria. - Name of the next search criteria name is displayed on LCD2. - Repeat above steps 2 and 3 for all other search criteria until instrument displays Report on LCD2. Instrument is now in report output date duration setting status. 4 output date duration parameters are available: - - Day = All transaction recorded on specified date - Month = All transaction recorded in specified month - Period = All transaction recorded within the specified period - All = All transaction recorded in Alibi Transaction Memory. - Press [MR] or [PF/Set] until the preferred output date duration parameter appears on LCD3 then press [Print/M+]. - If Day is selected, enter the requested date value then press [Print/M+] to output. - If Month is selected, enter the first date of the requested month value (e.g. 17.12.01 for the month of December 2017) then press [Print/M+] to output. - If Period is selected, enter the requested starting date value then press [Print/M+] and then enter the requested ending date value then press [Print/M+] to output. - If All is selected, press [Print/M+] to output.				
F35	Average Piece Weight	rC.Unit (Recall last Average Piece Weight before Powered Off) ** Off / On		AVG (Auto Unit Weight Enhancement Function) Off / ** On	
F36	Expiry Date	Expiry duration = **0 ~ 9999 Notes: - - XXX = Today + xxx day **0 =Today 1 = Tomorrow 14 = Today + 14 days Setting procedures: - - Enter expiry value through numeric keys then press [Print/M+] to confirm and save. - To clear an expiry value, press [CE/x10] then press [Print/M+].			

7. Recommended Setting Procedures for User

1. Power off instrument and remove power adaptor.
2. Complete connection with load receiving platform(s).
3. Complete all hardware connection with peripheral.
4. Apply power adaptor and power on.
5. Go to F1 and check internal count value. Verify connection with weighing platform(s) is correctly done, by applying and removing loads from weighing platform. Internal count value increases when extra loads are applied to weighing platform. Likewise, internal count value decreases when loads are removed from weighing platform.
6. Go to F2 and check and make sure no display segments or indicators are missing.
7. Go to F3 and make sure that capacity x division are correctly set.
8. Go to F4 to check and set date format and value.
9. Go to F5 to check and set time value.
10. Go to F6 to do system initialization.
11. Check and set all other operation parameters from F7, F8, F9.... F36 according to numeric order of the internal function number.
12. Conduct test runs to determine if the above settings best suit the application requirements. If not, set again the corresponding parameters.

Notes: -

- a. Some of the above internal functions are platform sensitive and it is possible to have different settings for PF#1 and PF#2 under the same internal function number.
- b. Complete first all settings/checking for P1. Then go to F1 again, press **[PLU]** to change to P2. Repeat above point #5 ~ #12 for P2.

Always contact your dealer for product information, after sales service and questions when in doubt.

8. UART & Comport Settings

An UART (Universal Asynchronous Receiver/Transmitter) is the communication device inside the MCU of this instrument which controls the communication device to which it is attached.

An UART can be converted into various transmission types (e.g. RS232, RS485, WIFI, LAN, Bluetooth, TTL) with the assistance of corresponding components.

A comport is the physically connection port to which an external equipment is connected with this instrument.

This instrument is equipped with 4 built-in UARTs. Refer to below table for transmission type and assigned comport number.

8.1 UART Transmission Type & Assigned Comport No. Table

UART #	Transmission Type	Connected to Comport #	Remark
UART 0	RS232	Comport 0	Standard
UART 1	TTL Output	Contact dealer for support	Standard
	RS485		Optional
UART 2	RS232	Comport 2	Standard
	Bluetooth	N.A.	Optional
UART3	WIFI	N.A.	Optional
	LAN	Contact dealer for support	Optional

Note: - only one transmission type can be selected per each UART.

Setting procedures⁴: -

1. Go to F16 then press **[Print/M+]**.
2. Name of the current UART # appears on **LCD2**.
3. Press **[PF/Set]** until the UART # (Uart 0 ~ 3) appears on **LCD2** then press **[Print/M+]**.
4. Press **[PF/Set]** or **[MR]** until the preferred transmission type appears on **LCD3** then press **[Print/M+]** to set data communication types. 7 parameters are available: -
 - Off = Disabled.
 - Auto 1 = Auto print when weight is stable.
 - Auto 2 = The highest stable weight value (of a weighing process) will be automatically printed when all loads are removed (and gross weight returns to zero or minus).
 - Auto 3 = The last stable weight value (of a weighing process) will be automatically printed when all loads are removed (and gross weight returns to zero or minus).
 - Manual = Manual output by pressing **[Print/M+]**.
 - PC = Continuous or selected periodic output of real time result according to predefined format.
 - CMD = Command communication and APP mode.
 - Scanner = Connect with a barcode scanner. (UART #0 and UART #2 only)

Notes: -

- If PC or CMD is set, refer to **paragraph 8.2** for rest of the setting.
 - If Auto 1 ~ 3 or Manual is set, refer to **paragraph 8.3** for rest setting.
5. Repeat above steps 1 ~ 4 for all other UARTs.

⁴ Auto 1 ~ 3 do not support PA.

8.2 Parameters Table for PC & Command & Scanner

Step No.	Set Item	Parameters	PC	CMD	SCANNER
1	Baud Rate	1200 ~ 921600 in 12 steps Default = 115200	■	■	■
2	Parity	None / Odd / Even Default = None	■	■	■
3	Data Length	7 / 8 Default = 8	■	■	■
4	Protocol Type Note G	Protocol 0 ~ 9 & Custom Default = Protocol 1	■	Completed	Completed
5	Transmission Interval Note A	0 ~ 300 (second) in 10 steps Default = 0	Completed		

8.3 Parameters Table for Auto 1 ~ 3 & Manual⁵

Step No.	Set Item	Parameters	Auto 1	Auto 2	Auto 3	Manual
1	Baud Rate	1200 ~ 921600 in 12 steps Default = 115200	■	■	■	■
2	Parity	None / Odd / Even Default = None	■	■	■	■
3	Data Length	7 / 8 Default = 8	■	■	■	■
4	Auto Accumulation Note B	Off / On Default = On	■	■	■	■
5	Check Control Note C	Off / On Default = Off	■	■	■	■
6	Stability Control Note D	Yes / No Default = Yes	■	■	■	■
7	Minimum Output Weight Note E	10 ~ 20d in 11 steps Default = 20d	■	■	■	■
8	Output Format Note F	Lab 1 ~ Lab 5, LP 50, TSC and Sbarco Default = Lab 2	■	■	■	■
9	Other Procedures		Note H ~ K			

Note A: - Transmission interval is the time interval (in second) between each output. 0 = continuous output.

Note B: - On = Auto Memory accumulation enabled.

Off = Auto Memory accumulation disabled.

Note C: - On = (When check function is in effect) Only OK value (value which is within Lo and Hi Limits) will be transmitted.

Off = (When check function is in effect) Check control is disabled.

Note D: - Yes = Only stable weight will be transmitted.

No = Transmission is activated when **[Print/M+]** is pressed disregarding the weight stable status.

⁵ Auto 1 ~ 3 do not support PA.

Note E: - Minimum weight value to be transmitted. Instrument will not generate any output if the actual weight is less than the minimum output weight selected here.

Note F: - Output format description: -

- Lab 1 = Output in landscape direction. Refer to **Appendix C** for more information.
- Lab 2 = Output in portrait direction. Refer to **Appendix D & E** for more information.
- Lab 3 = Database output mode. Refer to **Appendix F** for more information.
- Lab 4 = Journal output format with gross and net weight of each individual transaction. Refer to **Appendix G** for more information.
- Lab 5 = Journal output format with time and net weight of each individual transaction. Refer to **Appendix H** for more information.
- LP-50/TSC/Sbarco = Output to LP-50 / TSC / Sbarco label printer. Refer to **Appendix I ~ K** for details.

Note G: -

- Refer to **Appendix A** for Predefined PC Output Prot 1 ~ Prot 9.
- Refer to **Appendix B** for Customized PC Output Protocol.

Note H: - If Lab 1 is set in Print format, select line number then press **[Print/M+]** to save. Setup is then completed.

Note I: - If Lab 2 is set in Print format, select number of copy then press **[Print/M+]** to save. Setup is then completed.

Note J: - If Lab 3, 4 or 5 is set in Print format, press **[Print/M+]** to save. Setup is then completed.

Note K: - If LP50/TSC/Sbarco is selected: -

- a. Select number of copy (1 ~ 8) and press **[Print/M+]** to continue the below setting,
- b. Select label file number (FL1 00 ~ FL1 99) to print in label format group 1 and press **[Print/M+]** to continue the below setting. FL1 00 = current transaction label printing output disabled.
- c. Select label file number (FL2 00 ~ FL2 99) to print in label format group 2 and press **[Print/M+]** to continue the below setting. FL2 00 = totaled (MR) data label printing output disabled.

8.4 Android and iOS APP

Android and iOS App are available to work with this instrument: -

- For Android App: - Visit Google Play and search for aConnect.
- For iOS App: - Visit Apple App Store and search for FMDirect.

These Apps support both Bluetooth and WIFI connection.

8.4.1 Settings when Using App via WIFI Connection

1. Make sure that the optional built-in WIFI or LAN module is ordered.
2. Set UART #3 of internal function F16 to WIFI or LAN depends on the options ordered. Then set transmission type to CMD.
3. Make sure that the weighing instrument and your smart device is under the same Network / SSID.
4. Enter the IP and port number of the built-in WIFI / LAN module on the starting page of the APP.
5. Once the IP and port numbers are entered, APP starts automatically.

Contact your dealer for support / more setting information about built-in WIFI / LAN module.

8.4.2 Settings when Using App via Bluetooth Connection

1. Make sure that the optional built-in Bluetooth 2.0 module is ordered.
2. UART #2 of internal function F16 should be either set to BT. Then set transmission type should be set to CMD.
3. Bluetooth Type of internal function F50: -
 - For Android, set to BT2.0. Then set Bluetooth working type to Andro.
 - For iOS, set to BT4.0. Then set Bluetooth working type to iOS.
4. Then change or take note of the BT device name and pin number
5. Pair your smart device with the built-in BT2.0 module before starting the APP.
6. Start APP, and select the correct Bluetooth device on the starting page of the APP.
7. Once the correct Bluetooth name is selected, APP starts automatically.

Contact your dealer for support / more setting information about built-in Bluetooth module.

9. Basic Operation

9.1 Power Instrument On and Off

- To power on: - press **[On/Off]** and then release.
- To power off: - press **[On/Off]** and then release.

9.2 Power on Countdown Process

After powered on, instrument goes through the power on countdown process and display the below information.

1. Software number (LCD1) and version (LCD2).
2. All display segments.
3. Calibration count value (LCD2), parameter set count value (LCD3) and Battery voltage (LCD1).
4. Capacity & division set of P1 (LCD1) in the format of Max plus 1 division ($LCD2 = Max_1 + e_1$); ($LCD2 = Max_2 + d_2$).
5. Capacity & division set of P2 (LCD1) in the format of Max plus 1 division ($LCD2 = Max_1 + e_1$); ($LCD2 = Max_2 + d_2$).
6. At this point, depends on internal function number F28 setting, instrument may ask for operator number input. If this is the case: -
 - Input 4-digit operator number, or
 - Press **[CE/x10]** to skip operator number
7. Then press **[Print/M+]** to enter,
8. At this point, instrument is in weighing mode and is ready for operation.

9.3 Operator Code

If F28 is set to Yes, instrument will ask for operator code input during power on countdown process.

- Input operator code: - when prompted, input 4-digit operator code then press **[Print/M+]**. If a barcode scanner is connected, then simply scan the operator number barcode.
- To clear operator code: - when prompted, press **[CE/x10]** then press **[Print/M+]**.

Once an operator code entered, instrument will automatically transmit the code entered in Lab 1, Lab 3, Lab 4 and Lab 5 output format.

9.4 Warm Up Time

Allow a warm up period of not less than 60 seconds after powered on before using.

9.5 Dual Platform Operation

If the secondary platform is ordered but it is not enabled, contact your dealer for support.

9.5.1 Select preferred weighing platform by [PF/Set]

To enable platform selection through the [PF/Set], set internal function F31 to **P.F.** After that, by pressing [PF/Set], instrument will shift among P1 only, P2 only and both. Platform (s) in operation is indicated by **P1** or **P2** or **PA** Indicator.

9.5.2 Summing up transaction results of both platforms

Transaction results of P1 and P2 can be totalized (sum total). To enable platform selection through the [PF/Set], set internal function F9 to **On**.

- When only **P1 Indicator** appears = Only P1 is in operation.
- When only **P2 Indicator** appears = Only P2 is in operation.
- When both P1 and P2 indicators appear = Both P1 and P2 (hereinafter P1 + P2 is referred as PA) are in operation and transaction results of both platforms are totalized and being displayed.

9.6 Keyboard Lock

When keyboard lock is enabled in F20, only [On/Off], [Zero], [Tare] and [On/Off] keys can function during normal operation.

9.7 Loads and Weighing Platform

- Always place an object onto platform gently. Excessive force / shock applied to platform may cause unrecoverable damage to the weight sensor inside platform.
- It is a good practice to remove all loads from platform after weighing. It will prolong the life of the weight sensor.

9.8 Manual Zero

If zero weight cannot be obtained when unloaded, press [Zero]. **Zero Indicator** lights up when instrument is at zero status.

9.9 Tare Functions

9.9.1 Manual and automatic tare

This instrument is equipped with the below auto tare functions. These functions can be selected in F12.

- Off: - Manual Tare
- Auto: - Instrument will assume the first stable weight ($\geq 20d$ or $20d_1$) applied is a container and will then tare off the weight of it automatically. When container is removed and gross weight result is zero, tare effect will be cancelled automatically.
- Contin (continuous auto tare): - All stable weight ($\geq 20d$ or $20d_1$) applied will be tared off automatically. When all loads are removed and gross weight result is zero, tare effect will be cancelled automatically.

Notes: -

- If Contin is set, select also d.t. (delay time, 0.0 ~ 9.9 second. **Default = 1.5 second**).
- Delay time is the time duration from when a stable weight is detected until it is automatically tared off.
- Enter the preferred d.t. value through numeric keys and then press [Print/M+] to save.

9.9.2 Repetitive / multiple tare

This instrument is equipped with multiple tare operation. F13 is required in a weighing process, set F13 to On.

- Set F13 to on to allow multiple tare operation in a single weighing operation. If it is the case, instrument will permit multiple tare operation and tare effect can only be cancelled when there is no load on the platform.
- Set F13 to off to reject multiple tare operation in a single weighing operation. If this is the case, tare effect can only be cancelled when container is removed and gross weight is zero.

9.9.3 Preset tare

Preset tare allows a pre-determined tare weight value can be entered via numeric keys.

9.9.3.1 Introduce a preset tare value

Enter the pre-determined tare weight value through numeric keys then press **[Print/M+]** to enter. After the pre-determined tare value has been entered: -

- Instrument displays the preset tare value entered.
- **Net indicator** appears to indicate the value being displayed is net weight.

9.9.3.2 Cancel a preset tare value

A preset tare value can be cancelled by entering a zero preset tare value (numeric 0) then press **[Print/M+]**.

9.10 Auto Power Saving & Auto Power off Time

This instrument is equipped auto power saving and auto power off time function. Refer to **F7** on **paragraph 6.5** for details.

9.11 Expiry Date

This instrument support expiry date output according to predetermined expiration period. If expiry date is required for operation, enter the expiry duration in internal function F36. Refer F36 of **paragraph 6.5** for details.

9.12 Print a Customer & Product Code Entered⁶

Once a customer/product code is entered, it will be printed automatically through the assigned comport.

9.13 Inputting Numbers, Letters, Symbols by Keyboard

This instruction supports numbers, letters and some select symbols entries through keyboard. To enable symbol and letter entry through keyboard, set **F30** to **Yes**.

Default setting for letter is = upper case, to change to lower case letter, press **[Check]**. Lower case indicator appears to denote lower case letter entry is in effect.

Cursor location of current entry is indicated by flashing decimal sign at its right side. Refer to below table for input assignment.

⁶ Print format Lab 1 does not support customer/product code.

Numbers, Letters, Symbols Assignment Table

Key	Assignment				
0	0	Space			
1	1	-	/	_	
2	2	A	B	C	
3	3	D	E	F	
4	4	G	H	I	
5	5	J	K	L	
6	6	M	N	O	
7	7	P	Q	R	S
8	8	T	U	V	
9	9	W	X	Y	Z
Check	Shift				

10. Count Function

Before count transaction / process: -

1. Remove all loads from weighing platform.
2. If zero weight cannot be obtained when unloaded, press **[Zero]**. After **[Zero]** is pressed, the **Zero Indicator** will appear.
3. If a container is needed, place it onto the platform and press **[Tare]** manually (in case auto tare is not enabled).

10.1 Obtain Unit Weight

Average Piece Weight is the basic of all piece count transaction / process. Average Piece Weight can be created and obtained through one of the below methods: -

- a. Direct unit weight entry method.
- b. Sampling method.
- c. Employ last unit weight when power on
- d. Recall from quick PLU.

10.1.1 Direct unit weight entry method

This method is used when unit weight is known. Procedures: -

1. During normal operation status, enter the unit weight through numeric keys, then press **[@WT]**.
2. Unit weight entered is then displayed on LCD3

10.1.2 Sampling method

This method is used when the unit weight is not known. Procedures: -

1. Apply samples with known quantity on weighing platform.
2. Enter quantity through numeric keys, then press **[@QTY]**.
3. Calculation unit weight is then displayed on LCD3.

10.1.3 Employ the last unit weight when power on

To employ this function, set F35 **rC.unit** = On. Under this setting the last unit weight (before powered off) will be employed automatically when powered on again.

To disable this function, set F35 **rC.unit** to Off.

Note: - Unit weight obtained by this function is not supported by Auto Unit Weight Enhancement Function

10.1.4 Recall unit weigh unit from quick PLU

Refer to **paragraph 11.1.2** for details.

10.2 Start Counting Process

Once unit weight is entered (by either method listed on **paragraph 10.1**, instrument is ready for counting operation. By adding more to or removing some from weighing platform, the corresponding quantity will be displayed on LCD1 automatically.

10.3 Auto Unit Weight Enhancement Function

In order to obtain the best counting result and minimize sampling error, this instrument is equipped with Auto Unit Weight Enhancement Function. This function will automatically be employed when unit weight is determined by sampling method⁷.

Auto Unit Weight Enhancement Function starts automatically when **all** of the below are met: -

- a. Unit weight is obtained by sampling method as listed on **10.1.2**.
- b. $6 \text{ pieces} \leq \text{quantity added} \leq 9999 \text{ pieces}$.
- c. $6 \text{ pieces} \leq \text{quantity added} \leq 100\% \text{ of last total quantity on weighing platform}$.
- d. When all the above requirements are met, a new unit weight will be calculated and displayed on LCD3 automatically.

Notes: -

1. To enable this function, set F35 **AVG** = On.
2. To disable this function, set F35 **AVG** = Off.
3. Auto Unit Weight Enhancement Function stops automatically when total quantity on weighing platform reaches 10000 pieces or more.

10.4 Check Function^{8 9 10}

Check function is used to compare current weighing or counting result with the preset Lo and Hi Limit. The comparison results (Lo, OK, Hi) will then be displayed in different backlight colors with or without buzzer¹¹. Check results are also sent to Control Output Port¹².

Check functions accept various values value and targets for P1 and P2. Settings for P1 and P2 are independent to each other.

⁷ Refer to **paragraph 10.1.2** for details.

⁸ Check mode will not operate when weight is less than 20d (or 20d1 for dual weighing range/interval mode).

⁹ Set also F15 for desired Check buzzer output.

¹⁰ If necessary, set F26 to meeting operation requirements.

¹¹ Set F15 for preferred buzzer output configuration.

¹² Refer to **paragraph 4.3** for details.

10.4.1 Check types and target

Below 2 types of check target are available.

- Quantity Check: - Check target = quantity value
- Weight check Count: - Check target = weight value.

Average Piece Weight is the basic of all piece count transaction / process. Average Piece Weight can be created and obtained through one of the below methods: -

- a. Direct entry method.
- b. Employ last unit weight when power on
- c. Recall from quick PLU.

10.4.1.1 Direct entry method

1. Enter check type: -
 - For quantity check, press **[QTY]** then press **[Check]**.
 - For weight check, press **[@WT]** then press **[Check]**.
2. Instrument displays **Low** on LCD1.
3. Enter Lo weight check limit through numeric key then press **[Print/M+]**.
4. Instrument displays **High** LCD1.
5. Enter Hi weight check limit through numeric key the press **[Print/M+]**.
6. Instruments returns to normal operation status.

At this point, weight check limit is saved and in effect.

10.4.1.2 Employ last check type and limits when power on

Last check type and limits (before powered off) will be employed automatically when powered on again.

10.4.1.3 Recall check type and limits from quick PLU

- For quantity check: - Refer to **paragraph 11.2.2** for details.
- For weight check: - Refer to **paragraph 11.3.2** for details.

10.4.2 Hints for entering Lo and Hi limits

- For normal comparison, set both Lo and Hi limits.
- To check only if result is lower than or equal to Lo ($\text{result} \leq \text{Lo}$), set Hi Limit = 0.
- To check only if result is higher than or equal to Hi ($\text{result} \geq \text{Hi}$), set Lo Limit = 0.
- To check if result is equal to a specified value, set both Hi Limit and Lo Limit = the specified value.

10.4.3 Cancel check function

To clear check function, follow **paragraph 10.4.1.1** and enter zero value by pressing **[CE/x10]** in steps **2** and **4**.

10.4.4 Check Function priority rules for dual platform (PA) operation

Instrument follows the below priority rule numbers to determine the Lo and Hi check limits for dual platform (PA) operation.

1. The platform with larger capacity.
2. The platform with larger division value.
3. P1 when both platforms have the identical capacity and division settings.

10.4.5 Relay output

If optional relay output is equipped: -

- Relay 1 output synchronizes with buzzer.
- Relay 2 output synchronizes with Lo.
- Relay 3 output synchronizes with OK.
- Relay 4 output synchronizes with Hi.

Note: - Set internal function F15 to enable/disable buzzer output.

10.5 Memory Accumulation

Below memory accumulation modes are available for each Uart port: -

- a. Memory accumulation disabled.
- b. Manual accumulation.
- c. Automatic accumulation.

Notes: -

- During counting operation, both net weight and piece value will be accumulated.
- Date stored will not be erased when powered off.
- Data stored will be erased when operator code is changed.

10.5.1 Memory accumulation settings

To enable/disable memory accumulation, an Uart should be set to one of the following modes: - Auto 1; Auto 2; Auto 3; Manual.

- To enable memory accumulation, set Auto Accumulation to On in internal function number F16.
- To disable memory accumulation, set Auto Accumulation to Off in internal function number F16.

Refer to step 4 of **paragraph 8.3** for setting details.

10.5.2 Manual accumulation

Press **[Print/M+]** to accumulate the current value to memory.

10.5.3 Automatic accumulation¹³

Automatically memory accumulation of an Uart is activated automatically when **Auto Accumulation** is set to **On** in Auto 1, Auto 2, Auto 3. Under the automatic accumulation mode, corresponding results will be accumulated automatically.

Unstable results or results which are less than 20d (or 20d₁ for dual weighing range/interval mode) will not be automatically accumulated.

10.5.4 When data is accumulated to memory

When a result is accumulated to memory: -

- Instrument displays “**n_____x**” on LCD3.
- **M+ Indicator** appears to indicate that memory contains stored data. “x” means the total number of transactions accumulated to memory.
- This instrument returns to normal display status after 2 seconds.

¹³ Auto 1 ~ 3 do not support PA.

10.5.5 Memory recall and clearance

To recall memory, press **[MR]** to recall total accumulated summary.

- Number of accumulations is displayed on LCD3.
- Total accumulated weight is displayed on LCD2.
- Total accumulated piece number is displayed on LCD1.

At this point, press **[Zero]** to return to operation or press **[CE/x10]** to clear memory.

10.5.6 Dual platform accumulation rules

This instrument provides independent memory to store accumulation data from P1 and P2. Refer to **paragraph 9.5.1** for how to select preferred weighing platform and **9.5.2** for how to sum up transaction results of both platforms.

10.5.6.1 Platform in use

- When only **P1 Indicator** appears, only transaction data of **P1** will be accumulated and save. **[MR]** and memory clearance refers to **P1** only.
- When only **P2 Indicator** appears, only transaction data of **P2** will be accumulated and save. **[MR]** and memory clearance refers to **P2** only.
- When both **P1** and **P2** indicators appear = transaction data of both platforms will be accumulated and save. **[MR]** and memory clearance refers to both platforms.

10.5.6.2 Dual platform accumulation rules

When dual platform (PA) operation is selected, transaction data will only be accumulated to memory when all below conditions are met.

- Weights on both platforms are higher than 20d and started from zero or negative, and
- Weights on both platforms are stable.

10.5.6.3 Accumulation data illustration for PA

MR data of PA is the sum up results of P1 and P2. The following data of P1 and P2 is summed up and then displayed when **[MR]** is pressed.

- Accumulation sequence (Seq).
- Accumulated weight.
- Accumulated quantity.

Platform No.	Accumulation Sequence	Accumulated Weight	Accumulated Quantity
P1	4	30.000kg	3000pieces
P2	8	50.000kg	5000piece
PA	12	80.000kg	8000pieces

11. Quick PLUs

This instrument is equipped with 10 quick PLUs for each for the below. Some of these quick PLUs may accept various values for P1 and P2. If it is the case, settings for P1 and P2 are independent to each other.

- a. Unit weight
- b. Quantity check limit (Quick PLU settings for P1 and P2 are independent to each other)
- c. Weight check limit (Quick PLU settings for P1 and P2 are independent to each other)
- d. Preset tare value (Quick PLU settings for P1 and P2 are independent to each other)
- e. Product code and product description
- f. Customer code and customer description

11.1 Unit Weight Quick PLU

11.1.1 Create & save unit weight to quick PLU

Procedures: -

1. During normal operation status, enter the unit weight through numeric keys.
2. Long press **[@WT]**. Instrument displays **Save** on LCD1.
3. Save unit weight to a preferred quick PLU by pressing the quick PLU number (0~9), then press **[Print/M+]**.
4. Instrument displays **Done** on LCD3.

At this point, unit weight is saved and in effect.

11.1.2 Recall unit weight from quick PLU

Procedures: -

1. During normal operation status, press **[0]** then press **[@WT]**.
2. Instrument displays **Recall** on LCD1.
3. Press the preferred quick PLU number (0~9), then press **[Print/M+]**.
4. Instrument displays **Done** on LCD3.

At this point, selected unit weight is recalled and in effect.

11.1.3 Clear unit weight from quick PLU

To clear unit weight from quick PLU, follow **paragraph 11.1.1** and enter zero value in step 1.

11.2 Quantity Check Limit Quick PLU

11.2.1 Create & save quantity check limit to quick PLU

Procedures: -

1. If more than one weighing platform is used, shift to the preferred platform # by pressing **[PF/Set]**.
2. During normal operation status, press **[Qty]** then **[Check]**.
3. Enter Lo quantity check limit through numeric key then press **[Print/M+]**.
4. Enter Hi quantity check limit through numeric key then long press **[Check]**.
5. Instrument displays **Save** on LCD1.
6. Save quantity check limit to a preferred quick PLU by pressing the quick PLU number (0~9), then press **[Print/M+]**.

At this point, quantity check limit is saved and in effect.

11.2.2 Recall quantity check limit from quick PLU

Procedures: -

1. If more than one weighing platform is used, shift to the preferred platform # by pressing **[PF/Set]**.
2. During normal operation status, press **[Qty]** then **[Check]** then **[PLU]**
3. Instrument displays **Recall** on LCD1.
4. Press the preferred quick PLU number (0~9), then press **[Print/M+]**.
5. Instrument displays the recalled Lo and high quantity limit then returns to operation status.

At this point, selected quantity check limit is recalled and in effect.

11.2.3 Clear quantity check limit from quick PLU

To clear quantity check limit from quick PLU, follow paragraph 11.2.1 and enter zero value in steps 3 and 4.

11.3 Weight Check Limit Quick PLU

11.3.1 Create & save weight check limit to quick PLU

Procedures: -

1. If more than one weighing platform is used, shift to the preferred platform # by pressing **[PF/Set]**.
2. During normal operation status, press **[@WT]** then **[Check]**.
3. Enter Lo weight check limit through numeric key then press **[Print/M+]**.
4. Enter Hi weight check limit through numeric key then long press **[Check]**.
5. Instrument displays **Save** on LCD1.
6. Save weight check limit to a preferred quick PLU by pressing the quick PLU number (0~9), then press **[Print/M+]**.

At this point, weight check limit is saved and in effect.

11.3.2 Recall weight check limit from quick PLU

Procedures: -

1. If more than one weighing platform is used, shift to the preferred platform # by pressing **[PF/Set]**.
2. During normal operation status, press **[@WT]** then **[Check]** then **[PLU]**
3. Instrument displays **Recall** on LCD1.
4. Press the preferred quick PLU number (0~9), then press **[Print/M+]**.
5. Instrument displayed the recalled Lo and high weight limit then returns to operation status.

At this point, selected weight check limit is recalled and in effect.

11.3.3 Clear weight check limit from quick PLU

To clear weight check limit from quick PLU, follow paragraph 11.3.1 and enter zero value in steps 3 and 4.

11.4 Preset Tare Value Quick PLU

11.4.1 Create & save preset tare value to quick PLU

Procedures: -

1. If more than one weighing platform is used, shift to the preferred platform # by pressing **[PF/Set]**.
2. During normal operation status, enter the preset tare value through numeric keys.
3. Long press **[Tare]**. Instrument displays **Save** on LCD1.
4. Save preset tare value to a preferred quick PLU by pressing the quick PLU number (0~9), then press **[Print/M+]**.
5. Instrument displays **Done** on LCD3.

At this point, preset tare value is saved and in effect.

11.4.2 Recall preset tare value from quick PLU

Procedures: -

1. If more than one weighing platform is used, shift to the preferred platform # by pressing **[PF/Set]**.
2. During normal operation status, press **[0]** then press **[Tare]**.
3. Instrument displays **Recall** on LCD1.
4. Press the preferred quick PLU number (0~9), then press **[Print/M+]**.
5. Instrument displays tare value recalled on LCD3 then returns to operation status.

At this point, selected preset tare value is recalled and in effect.

11.4.3 Clear preset tare value from quick PLU

To clear preset tare value from quick PLU, follow **paragraph 11.4.1** and enter zero value in step 2.

11.5 Product Code and Product Description¹⁴

11.5.1 Create & save product code and product description to quick PLU

Procedures: -

1. Go to F19, then press **[Print/M+]**.
2. Press **[PF/Set]** or **[MR]** until **P Code** appears on LCD2, then press **[Print/M+]** to confirm.
3. Instrument displays H code followed by the 1st 6 digits. Enter the first 6 digits of the code here, then press **[Print/M+]** to confirm.
4. Instrument displays M code followed by the 2nd 6 digits. Enter the 7th ~ 12th digits of the code here, then press **[Print/M+]** to confirm.
5. Instrument displays L code followed by the 3rd 6 digits. Enter the last 6 digits of the code here, then press **[Print/M+]** to confirm.
6. Instrument displays first 6 digits of description content.
7. Enter description starting from H, then M1, M2, M3 and finally L. Press **[Print/M+]** to confirm and end editing after last digit has been input.
8. Instrument displays **PLU = ?** on LCD3.
9. Save product code and product description to a preferred quick PLU by entering the quick PLU number (01~99) and press **[Print/M+]**.
10. Instrument displays **Done** on LCD3.
11. At this point, product code and product description are saved and in effect.

11.5.2 Recall product code and product description from quick PLU

Procedures: -

1. During normal operation status, long press any numeric number key (0 ~ 9).
2. Press **[PF/Set]** or **[MR]** until **P Code** appears on LCD1 and press **[Print/M+]**.
3. Instrument displays **PLU = 00** on LCD3.
4. Enter the 2-digit PLU number then press **[Print/M+]**.
5. Instrument displays customer code on LCD3.
6. At this point, selected product code and product description is recalled and in effect.

11.5.3 Clear product code and product description from quick PLU

To clear product code and product description quick PLU, follow **paragraph 11.5.1** and press **[Clear/x10]** then press **[Print/M+]** in step 3.

¹⁴ If Product Code is empty, product description will be ignored.

11.5.4 Applying blank product code and product description

To apply blank customer code and customer description: -

1. During normal operation status, long press numeric number key **0**.
2. Press **[PF/Set]** or **[MR]** until **P Code** appears on LCD1 and press **[Print/M+]**.
3. Instrument displays **PLU = 00** on LCD3.
4. Press **[Print/M+]** to confirm.
5. Instrument displays **Clear** on LCD3. At this point, product code and product description effect is cancelled.

11.6 Customer Code and Customer Description¹⁵

11.6.1 Create & save customer code and customer description to quick PLU

Procedures: -

1. Go to F19, then press **[Print/M+]**.
2. Press **[PF/Set]** or **[MR]** until **C Code** appears on LCD2, then press **[Print/M+]** to confirm.
3. Instrument displays H code followed by the 1st 6 digits. Enter the first 6 digits of the code here, then press **[Print/M+]** to confirm.
4. Instrument displays M code followed by the 2nd 6 digits. Enter the 7th ~ 12th digits of the code here, then press **[Print/M+]** to confirm.
5. Instrument displays L code followed by the 3rd 6 digits. Enter the last 6 digits of the code here, then press **[Print/M+]** to confirm.
6. Instrument displays first 6 digits of description content.
7. Enter description starting from H, then M1, M2, M3 and finally L. Press **[Print/M+]** to confirm and end editing after last digit has been input.
8. Instrument displays **PLU = ?** on LCD3.
9. Save customer code and customer description to a preferred quick PLU by entering the quick PLU number (01~99) and press **[Print/M+]**.
10. Instrument displayed **Done** on LCD3.
11. At this point, customer code and customer description are saved and in effect.

11.6.2 Recall customer code and customer description from quick PLU

Procedures: -

7. During normal operation status, long press the preferred PLU number (0 ~ 9).
8. Press **[PF/Set]** or **[MR]** until **C Code** appears on LCD1, then press **[Print/M+]**.
9. Instrument displays customer code on LCD3.

At this point, selected customer code and customer description is recalled and in effect.

11.6.3 Clear customer code and customer description from quick PLU

To clear customer code and customer description quick PLU, follow **paragraph 11.6.1** and press **[Clear/x10]** then press **[Print/M+]** in step 3.

11.6.4 Applying blank customer code and customer description

To apply blank customer code and customer description: -

1. During normal operation status, long press numeric number key **0**.
2. Press **[PF/Set]** or **[MR]** until **C Code** appears on LCD1 and press **[Print/M+]**.
3. Instrument displays **PLU = 00** on LCD3.

¹⁵ If Customer Code is empty, customer description will be ignored.

4. Press **[Print/M+]** to confirm.
5. Instrument displays **Clear** on LCD3. At this point, customer code and customer description effect is cancelled.

12. Customized Setting PLUs for Operation Settings & Parameters

This instrument is equipped with 100 Customized Setting PLUs for each of P1, P2 and PA. These PLUs are used to save all of the below operation settings/parameters of the current operation.

1. Platform No.
2. Customer Code
3. Customer Description
4. Product Code
5. Product Description
6. Unit Weight
7. Lo Check Limits and target (weight / quantity)
8. Hi Check Limits and target (weight / quantity)
9. Check Target (weight / quantity)
10. Auto Tare Type (i.e. Manual or Auto or Continuous)
11. Preset Tare Value
12. Date Format
13. Expiry Duration

12.1 Save Current Operation Settings/Parameters to Customized Setting PLU

Procedures: -

1. If more than one weighing platform is used, shift to the preferred platform # by pressing **[PF/Set]**.
2. Create and make sure that all the above-mentioned 12 operation settings and parameters (#2 ~#13) are correctly set and entered.
3. Long press **[PLU]**.
4. Instrument displays **Save** on LCD1.
5. Enter the preferred Customized Setting PLU number (01 ~ 99) through numeric key then press **[Print/M+]**.
6. Instrument displays **Done** on LCD3.

At this point, current operation settings/parameters are saved and in effect.

12.2 Recall Operation Settings/Parameters from Customized Setting PLU

12.2.1 By Instrument keyboard

Procedures: -

1. During normal operation status, press **[PLU]**.
2. Instrument displays **Recall** on LCD1.
3. Enter the preferred Customized Setting PLU number (01 ~ 99) through numeric key then press **[Print/M+]**.
4. Instrument displays preset tare value saved in this Customized Setting PLU on LCD3, then returns to normal operation status.

At this point, **Customized Setting Indicator** appears and selected operation settings/parameters are recalled and in effect.

12.2.2 By Execution Command

Refer to paragraph **M.3** on **Appendix M** for how to execute and recall a Customized Settings PLU.

12.3 Clear Customized Setting PLU

12.3.1 By Instrument keyboard

1. If more than one weighing platform is used, shift to the preferred platform # (under which the log PLU is save) by pressing **[PF/Set]**.
2. Long press **[PLU]** then **[CE/x10]**.
3. Instrument displays **Clear** on LCD1.
4. Enter the preferred Customized Setting PLU number (01 ~ 99) to clear through numeric key then press **[Print/M+]**.
5. Instrument displayed **Done** on LCD3.

At this point, current operation settings/parameters are cleared from PLU.

12.3.2 By Execution Command

Refer to paragraph **M.3** on **Appendix M** and enter 00 for PLU number.

12.4 Quit Current Customized Setting PLU Effect

Procedures: -

1. During normal operation status, press **[PLU]**.
2. Instrument displays **Recall** on LCD1.
3. Enter **00** through numeric key then press **[Print/M+]**.

At this point, **Customized Setting Indicator** disappears and instrument is running according to system setting.

13. Data Output Protocols & Formats

This instrument supports various PC data output protocol and output formats. Refer to below paragraphs and **paragraph 8** for details and setting procedures.

13.1 PC Output Protocols

- 9 predefined PC Output Protocols. Refer to **Appendix A** for details.
- 1 customized Output Format. Refer to **Appendix B** for details.

Note: - RS485 is not a suitable transmission mode for PC output protocol unless machine ID is set = blank in internal function F18.

13.2 Data & Print Formats

13.2.1 Predefined Output Formats

5 predefined output formats (Lab1 ~ Lab 5). Refer to below Appendixes for details.

- Lab 1 Output Format (**Appendix C**)
- Lab 2 Standard Output Format (**Appendix D**)
- Lab 3 Output Format (**Appendix F**)
- Lab 4 Output Format (**Appendix G**)
- Lab 5 Output Format (**Appendix H**)

13.2.2 Lab 2 Customized Output Format

This instrument supports customized Lab 2 output format. Refer to **Appendix E** for details.

13.2.3 Label Printing

This instrument supports the following label printer models: -

- LP50 by Datecs (www.datecs.bg/en)
- TDP247, TDP345, TTP247, TTP345 by TSC (www.tscprinters.com)
- All models with serial communication by Sbarco (<http://www.Sbarcotech.com>)

Notes: -

- Set all preferred operation parameters and label printer model according to paragraph **8**.
- Refer to **Appendix I** for TSC printer installation, setup procedures and detail on how to create and upload label to TSC printer by Bartender Label software.
- Refer to **Appendix J** for Sbarco Printer Installation, setup procedures and detail on how to create and upload label to Sbarco printer by BarDrawer software.
- Refer to **Appendix K** for detail on label programming and illustration samples.

14. Alibi Transaction Memory & Management Report

14.1 Alibi Memory Description

This instrument is equipped with Alibi memory to record all individual transaction records.

Management reports can be generated based on data saved in transaction memory, and: -

- Criteria set forth in F71 (supervisor password is needed to access this internal function), and
- Format set forth in F33, and
- Search criteria and time duration set forth in F34.

Notes: -

- The Alibi memory is independent to those data obtained through memory accumulation (e.g. manual memory accumulation by pressing **[Print/M+]** key and auto accumulation result by ACC = On in transmission type Manual and Auto 1 ~ Auto 3) during an operation.
- Maximum records can be saved = 131,072 transaction.
- When remaining memory is low: - Instrument displays Li xxx in power on countdown process. xxx is the number of memory remains before instrument starts overwriting historical records.
- When memory is full: - Instrument overwrites old records with new record based on first in first out principle.

An Alibi Management report is constructed of the followings: -

- a. Report Title show report output data range and search criteria.
- b. Report Header explain the nature of an output column.
- c. Content of Individual transactions.
- d. Footer showing 4 different kinds of totalized results. Refer to paragraph **14.4** for details.

To enable / disable Title, Header and Footer output, simply select **On** or **Off** when being asked. Refer to point #6 of F33 in paragraph **6.5** for settings.

Alibi Management Report Structure Illustration Table

2020-08-24 Daily Report Item : 35 Total Net: 111.558 kg Total Tare: 40.937 kg Total Gross: 152.495 kg Total Pieces 13251 pcs 8/24/2020 16:31 OK																					
Sys. Seq	Opr	Platform	Mac	MacGp	Date	Time	Ccode	C Description	Pcode	P Description	Gross	Tare	Net	Unit	@WT	@WT Unit	QTY	Low	High	Check Target	Result
0		P1			8/24/2020	16:19:48	Customer 3	Name 3	Product 3	P Description 3	2.5	0	2.5	kg	0	g	0	30	60	pcs	
1		P1			8/24/2020	16:19:51	Customer 3	Name 3	Product 3	P Description 3	2.5	0	2.5	kg	0	g	0	30	60	pcs	
2		P1			8/24/2020	16:20:01	Customer 3	Name 3	Product 3	P Description 3	2.5	0	2.5	kg	0	g	0	30	60	pcs	
32		P1			8/24/2020	16:26:21	Customer 22	Name 22	Product 22	P Description 22	2.5	0	2.5	kg	22	g	114	0.22	0.44	kg	Above
33		P1			8/24/2020	16:26:52	Customer 22	Name 22	Product 22	P Description 22	2.5	0	2.5	kg	22	g	114	0.22	0.44	kg	Above
34		P1			8/24/2020	16:27:02	Customer 20	Name 20	Product 20	P Description 20	12.5	7.499	5.001	kg	20	g	250	0.2	0.4	kg	Above

14.2 Define when a Transaction Data is saved to Alibi memory¹⁶

It is important to define first the timing at when the data of a transaction is saved to Alibi memory during system setup. To do so, go to F71 (supervisor password may be needed) and select the preferred parameter. 6 parameters are available.

- Off = No transaction will be recorded.
- Auto 1 = All stable weight (starts from gross zero or minus) is recorded by system automatically.
- Auto 2 = The highest stable weight value of a weighing process is recorded by system automatically (when all loads are removed and gross weight returns to zero or minus).
- Auto 3 = The last stable weight value of a weighing process is recorded by system automatically (when all loads are removed and gross weight returns to zero or minus).
- Manual = Transaction is recorded by system automatically when **[Print/M+]** is pressed.
- ACC = Transaction is recorded by system automatically when a new accumulated data is created automatically or manually.

¹⁶ Auto 1 ~ 3 do not support PA.

14.3 Output and Settings for Alibi Memory & Management Report

Complete both 2 procedures below to output management report.

1. Define report output comport and report content in F33. Refer to **F33 of Internal Function Table** on **paragraph 6** for details. Avoid assigning RS485 for report output unless Machine ID (set in F18) is = blank.
2. Define search for search criteria and date range in F34. Refer to **F34 of Internal Function Table** on **paragraph 6** for details. Multiple search criteria are acceptable based on condition "AND". For example, Operator Code number XXXX and Produce Code YYYY. All transactions which fulfil **both** these 2 criteria will be outputted.

14.4 Totalization

Except date range "All" is selected, instrument will automatically output the totalized data of below result at the end of the output.


- Total number of transactions of the date range
- Total Net Weight
- Total Gross Weight
- Total Piece Count

15. Barcode Scanner

To increase working efficiency, this instrument supports serial and Bluetooth barcode scanner which utilizes Bluetooth 2.0 for communication. Refer to paragraph 8.1 for setting details.

15.1 Using Barcode Scanner to Simulate Operation Key Input

To simulate **[ZERO]**, **[TARE]** and **[PRINT/M+]** key input, simply scan the corresponding barcodes below.

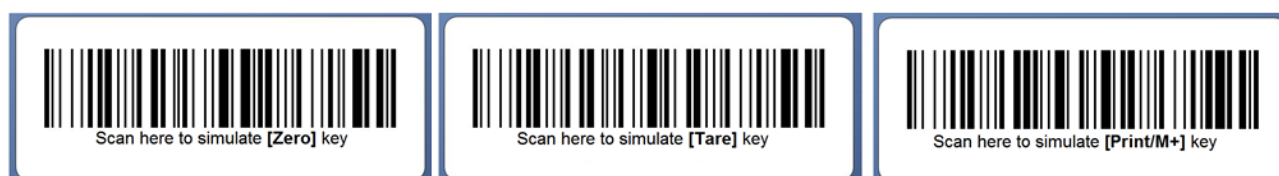

15.2 Inputting Customer & Product Code and Operator Number.

To change scanner input target, scan either one of the below barcodes, then scan a customer, product or operator number barcode.



15.2 Change to Different Input Target

Once an input target barcode is scanned (e.g. product code), instrument will assume all following barcode scanning is for the same input type (i.e. product code) unless a different input target will be scanned.

15.3 More about Customer / Product Code & Description

When a customer / product code barcode is scanned, instrument will first compare with the customer code / product code database saved in quick PLU #01 ~ #99 (refer to **11.5.1** and **11.6.1** for details) and for customer / product description. Then: -

- a. If a corresponding description has been created for the scanned customer / product code, then instrument will also carry out the corresponding description.
- b. If there is no corresponding description created for the scanned customer / product code, then instrument will leave the description blank.

16. Commands

The following types of command are available: -

- a. Keyboard commands are used to simulate key entries on keyboard.
- b. Execution commands are used to execute an action.
- c. System parameter & operation entry setting commands are used to send system parameters and operation entries to this instrument.
- d. System parameter reading commands are used to read system parameters.
- e. Operation entry reading commands are used to read those operation information entered (e.g. date, time, product and customer codes), current and accumulated operation results.
- f. Operation result reading commands are used to read current and accumulated operation results.
- g. Customized operation settings PLU saving commands are used to create and save customized operation settings to PLU.
- h. Customized operation settings PLU reading commands are used to read customized operation settings saved PLU.
- i. Quick PLU saving Commands are used to create and save operation settings to quick PLU.
- j. Quick PLU reading Commands are used to read operation settings saved in PLU.

Commands can be sent to this instrument from computer through any standard communication program. Refer to **Appendix L** to U for details of the above command types.

The Uart port which assigned for command communication should be set to CMD in F16. Refer to **paragraph 8** for setting details and procedures.

17. System Message & Error Code

17.1 System Message Table

Message	Description
--oL--	Overload (Gross weight is more than Max plus 9d).
bAt.Lo	Battery level low.
HALT	Major system error detected. Power off instrument and remove power adaptor immediately. Then check load cell connection and system power status.
L.i = xxx	- Remain system memory is = xxx. System will start overwriting historical transaction records (on FIFO basic) when system memory is completely full. To preserve historical data in system memory, output all transaction records in system memory to external backup file asap. - To clear this message, press [Print/M+] followed by [CE/x10].
UndEr	Negative Weight value exceeds display range.
Reboot	Important parameters have been changed. Power off and then power on instrument again to reboot.
-----	Negative Tare value exceeds display range.

17.2 Error Code Table

Error Code	Description
Err 1	Time value error
Err 2	Date value error
Err 3	Exceed manual zero
Err 4	Offset out of range / unstable during power on
Err 5	No load cell detected
Err 6	Tare operation error
Err 7	Logic error. Hi limit set is lower than Lo limit (and Hi is not = 0)
Err 8	Logic error. Lo limit set is higher than Hi limit (and Hi is not = 0)
Err 13	Exceed maximum power on
Err 19	Capacity or division setting error (Division set is higher than 10000d)
Err 22	Manual Zero and Tare stability error
Err 23	Capacity setting error, Capacity 1 > Capacity 2
Err 24	Division setting error, d ₁ > d ₂
Err 25	Span gain is too low
Err 26	Not able to obtain stable status for longer than 10 seconds
Err 27	- Calculated value per e of Cal 2 varies more than 1% as of Cal 1. Properly a load cell problem. - Mass value of Cal 2 is less than 150% of Cal 1.

Err 28	Maximum accumulation limit is exceeded
Err 29	Standard deviation data exceed memory size (300 transactions)
Err 30	Working mode (Operation mode AP or STA or AP&STA)
Err 31	WAN Setting
Err 32	Network Protocol Setting
Err 33	LAN Setting
Err 34	Cannot access to command mode of WIFI module
Err 35	STA SSID & KEY Setting
Err 36	AP SSID & KEY Setting
Err 38	Cannot Reload Setting
Err 39	Cannot read MAC of Link
Err 40	Lan Port Communication Error
Err 42	Cannot communicate with Bluetooth module
Err 43	Cannot set Bluetooth module
Err 44	Report output from RS485 port but Machine ID not = blank
Err 46	PLU recalled is blank

18. Daily Care & Maintenance

- Clean the instrument with a soft, damp cloth. If necessary, use a mild detergent in water.
- Do not use any harsh, abrasive material, acetone, volatile solvent, thinner or alcohol for cleaning.
- Verify the accuracy of this instrument periodically. Re-calibrate if necessary. In some countries, calibration requires authorized/qualified agent. Contact your dealer for more information.
- Store this instrument in a dry and clean place.
- Recharge battery before and every 4 months during long time storage.

Appendix A: - Pre-Defined PC Output Protocols

A.1 Data Abbreviation Table

Data Code	Description
,	Comma
+, -	Polarity Sign Positive = space. Negative = minus (-)
P	Polarity Sign Positive = 0. Negative = minus (-)
A	7 digits ADC value with lead space
G/N	Gross/Net - NT = Net weight - GS = Gross weight
NET	Net Weight
S	Status Code - ST for Stable - US for unstable
R	Revered 7 digits weight value including location of decimal point. If there is no decimal point, then the last character = space.
SP	Space
SWA	Status Word A
SWB	Status Word B
U	Weight Unit - kg = kilogram - lb = pound - g(space) = gram
W	7 digits weight value including location of decimal point. If there is no decimal point, then the first character = space.

A.2 Output Formats Tables

Protocol 0 Output Format

Position	1	2	3	4	5	6	7	8	9	10
Data	+, -	A	A	A	A	A	A	A	CR	LF

Protocol 1 Output Format

Position	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18
Data	S	S	,	G/N		+, -	W	W	W	W	W	W	W	,	U	U	CR	LF

Protocol 2 Output Format

Position	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17
Data	STX	SWA	SWB	SP	Field 1 (Net Weight)						Field 2 (Tare Weight)						CR

Protocol 3 Output Format

Position	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19
Data	SOH	STX	SP	+, -	W	W	W	W	W	W	W	SP	U	U	SP	SP	SP	SP	CR

Protocol 4 Output Format

Position	1	2	3	4	5	6	7	8	9
Data	=	R	R	R	R	R	R	R	P

Protocol 5 Output Format

Position	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18
Data	S	S	,	G/N		,	+, -	W	W	W	W	W	W	W	U	U	CR	LF

Protocol 6 Output Format

Position	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16
Data	N	E	T	SP	+,-	W	W	W	W	W	W	W	U	U	CR	LF

Protocol 7 Output Format

Position	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19
Data	SOH	STX	SP	+,-	W	W	W	W	W	W	W	SP	U	U	SP	SP	SP	CR	C

Protocol 8 Output Format

Position	1	2	3	4	5	6	7	8	9	10
Data	STX	+,-	W	W	W	W	W	W	W	ETX

Protocol 9 Output Format

Position	1	2	3	4	5	6	7	8	9	10	11	12
Data	STX	+,-	SP		W	W	W	W	W	U	U	ETX

Appendix B: - Customized PC Output Protocol

This instrument supports customized PC output protocol. Under this mode: -

- 2 data separation types
- 7 control codes, and
- 26 different transaction data

are available from instrument.

B.1 Customized PC Output Protocol Setting Procedures

1. Go to F16 and select the preferred UART number depends on the output comport number.
2. Select PC, then set baud rate, parity and data length.
3. Select Custom in Protocol page. Then press **[Print/M+]**.
4. Instrument displays **Separa** then followed by data separator selection page.
5. Select preferred data separator CoMMA (comma) or SemiCo (semi colon) then press **[Print/M+]**.

Notes: -

- Data separator is a symbol inserted between transaction data and is usually used by computer program to separate various data.
 - No data separator is inserted between in front or after control commands.
 - Separator in front and after a control code (C1 ~ C6) will not be surpassed. For example: - STXdata,data,dataETX
 - Exception of above is when control codes are in between 2 data. For example: - data,CR LF data
6. Instrument displays Item Number, then followed by the content page.
Note: - Item number means output sequence, e.g. Item 1 = the first content to output, Item 3 = the third content to output.
 7. Press **[PF/Set]** and **[MR]** until the preferred content appears then press **[Print/M+]**. Refer to below **Customized PC Output Content Table** for details.
 8. Repeat step **6** to include other transaction data or control.
 9. To complete and save a customized output, select **End** then press **[Print/M+]**.
 10. Then select output time interval (refer to **paragraphs 8.1 & 8.2** for details).
 11. Press **[Print/M+]** to save.

B.2 Customized PC Output Content Table

Symbol	Explanations	Nature	No. of Digit	Remarks
CoMMA	Comma	Data Separator	1	Select either one
SemiCo	Semi Colon		1	
Cr LF	HEX Code 0D 0A	Control Code	2	
Cr	HEX code 0D		1	
LF	HEX code 0A		1	
SOH	HEX code 01		1	
STX	Hex code 02		1	
ETX	Hex code 03		1	
Status	Weigh Status	Transaction Data	2	- ST = Stable - US = Unstable - OL = Overload
nT-GS	Net/Gross Sign		2	NT = Net / GS = Gross
Date	Date of Output		10	
Time	Time of Output		8	
Net	Net Weight		8	Numeric value only, without weight unit
Tare	Tare Weight		8	
Gross	Gross Weight		8	
Unit	Weight Unit		2	- kg = Kilogram (space)g =gram
H ref	Hi Limit		8	8-digital including decimal (if any)
L ref	Lo Limit		8	8-digital including decimal (if any)
Ck res	Comparison Result		2	Lo/Ok/Hi / Grade Result for grading
id	Machine ID		2	00 ~ 98, Blank = None
Group	Machine Group Number		2	00 ~ 99, Blank = None

Op Code	Operator Number	Transaction Data	4	0000 ~ 9999, **** = None
P Code	Product Code		1 ~ 18	Blank = not entered
P-Desc	Product Description		1 ~ 24	Blank = not entered
C Code	Customer Code		1~ 18	Blank = not entered
C-Desc	Product Description		1 ~ 24	Blank = not entered
Trans	No. of accumulated transaction		8	Blank = none
ACC	Total Accumulated Weight		8	Blank = none
unit.Wt	Unit weight		8	8-digital including decimal (if any) in terms of gram
Qty	Number of piece		8	8-digital
t._Qty	Total Accumulated Pieces		8	8-digital
P.F.	Platform #		2	• P1 = PF1 • P2 = PF 2 • PA = Dual Platform
t._GS	Accumulated Gross Weight		8	8-digital including decimal
t._Tare	Accumulated Tare Weight		8	
Expiry	Expiry Duration		8	
End	End of Input		None	

Appendix C: - Lab 1 Output Formats

Lab 1 Print Format¹⁷

When Lab 1 is selected, output in default format will be generated with printed data is sent. No header will be generated when line number is set = 00. See below table for print format and explanations.

Lab 1 Output Format Illustration Table

Date	Time	Seq	Platform #	Net	Tare	Gross	Total_WT	QTY	@WT	Total_QTY	Ref.	Result
2018/8/19	11:51:31	5	P2	10.00kg	0.00kg	10.00kg	80.00kg	5000	2.00000g	40002	kg	Below
2018/8/19	11:54:09	1	P1	10.00kg	2.64kg	12.64kg	10.00kg	4999	2.00000g	45001	kg	Accept
2018/8/19	11:54:58	8	PA	20.00kg	2.64kg	22.64kg	110.00kg	10000	2.00000g	55001	kg	Below
2018/8/19	12:10:37	10	PA	20.00kg	2.64kg	22.64kg	130.00kg	10000	2.00000g	65001	pcs	Accept

Notes: -

- Date = Date of Output
- Time = Time of Output
- Seq = Accumulate Sequence No.
- Platform # =
 - P1 = Platform #1, P2 = Platform #2, PA = Dual platform
- Net = Net Result
- Tare = Tare Weight
- Gross = Gross Weight
- Total_WT = Total Accumulated Weight
- Qty = Quantity
- Total_QTY = Total Accumulated Quantity
- @WT = Unit Weight
- Ref = Check Target
 - kg = weight in kilogram, g= weight in gram , pcs = quantity
 - Result = Check Results: Accept= Ok, Below = Lo, Above = Hi

¹⁷ Lab 1 format does not support Customer or Produce Code or Lab 1 output format.

Appendix D: - Standard Lab 2 Output Format

Standard Lab 2 Output Format Illustration Table

Time	12:24:18	<i>Time of Output</i>
Date	2018/8/19	<i>Date of Output</i>
Seq	11	<i>Accumulate Sequence No.</i>
Platform #	P1	<i>Platform No.</i>
Name	Product Code	<i>Customer Code</i>
Line for Customer Description		<i>Customer Code Description</i>
Pcode	Product Code	<i>Product Code</i>
Line for Product Description		<i>Product Code Description</i>
Net	10.00kg	<i>Net Weight</i>
Total_WT	120.00kg	<i>Total Accumulated Net Weight</i>
QTY	4999pcs	<i>Quantity</i>
@WT	2.00000g	<i>Unit Weight</i>
Total_QTY	59990pcs	<i>Total Accumulated Quantity</i>
<i>One Blank Line is inserted here</i>		
High	20.00kg	<i>Hi Limit</i>
Low	10.00kg	<i>Lo Limit</i>
Result	Accept	<i>Check Result</i>

Appendix E: - Customized Lab 2 Output Format

25 variants + 2 commands (**Cr LF** and **End**) are available for customized Lab 2 output format. Refer to the below table for more detail.

E.1 Customized Lab 2 Output Format Variants Table

Symbol	Description
End	Edit finished
CrLF	Insert one blank row
dAtE	Date of printing
time	Time of printing
nEt	Net weight
tArE	Tare weight
GroSS	Gross weight
unit.Wt	Unit weight
Qty	Number of piece
HrEF	Hi limit
LrEF	Lo limit
ChrES	Comparison result
trAnS	Transaction sequent number (if this transaction is accumulated to memory)
ACC	Total accumulated weight (when accumulation function is in effect)
SiGn	Signature
PCode	Product Code
P-Desc	Product Description
Id	Machine ID
GrouP	Machine group number
oPCodE	Operator number
CCode	Customer Code
C-Desc	Product Description
Week	Week No.
P.F.	Platform No.
t_ GS	Accumulated Gross Weight
t_ Tare	Accumulated Tare Weight
Expiry	Expiry Date
End	End of Input

E.2 Edit Customized Lab 2 Print Output Format

Follow the below steps to create customized printout.

1. Go to internal function F22. Press **[PF/Set]** or **[MR]** until **Custom** appears.
2. Press **[Print/M+]**,
3. This instrument displays **Line 1** and the last variant or command (refer to **paragraph E.1** for details) stored,
4. Press **[Print/M+]** to confirm or select other variant or command by press **[PF/Set]** or **[MR]**. Then press **[Print/M+]** to confirm and save,
5. This instrument displays **Line 2** and the last variant or command stored,
6. Repeat steps **4** and **5** for other lines,
7. To finish editing, select command **End**, then press **[Print/M+]** to confirm,
8. This instrument returns to and displays the current internal function number.

At this point, customized print output is completed.

Appendix F: - Lab 3 Output Formats

Current working mode and all related data are sent under this mode. Refer to below table for data output format. Semi colon is inserted between data.

Lab 3 Output Format Illustration Table

Data Output	Output Content
Data 1	Operator Number
Data 2	No. of Accumulated Transaction
Data 3	Platform Number
Data 4	Machine ID
Data 5	Machine Group Number
Data 6	Date of Output
Data 7	Time of Output
Data 8	Customer Code
Data 9	Product Code
Data 10	Gross Weight
Data 11	Tare Weight
Data 12	Net Weight
Data 13	Accumulated Weight
Data 14	Weight Unit
Data 15	Quantity
Data 16	Unit Weight
Data 17	Weight Unit of Unit weight
Data 18	Lo limit
Data 19	Hi limit
Data 20	Check Target
Data 21	Comparison Result
Data 22	Total Accumulated Pieces

Appendix G: - Lab 4 Output Format

Transaction data is sent in journal output format with quantity and net weight of each individual transaction. Refer to below for details.

Lab 4 Output Format Illustration

Data Explanation

Name Customer Code	<i>Customer Code (if entered)</i>
Pcode Product Code	<i>Product Code (if entered)</i>
Opr 8888	<i>Operator Code (if entered)</i>
Mac 11	<i>Machine ID (if entered)</i>
MacGp 22	<i>Machine Group Number (if entered)</i>
Date 2018-08-19	<i>Date of 1st output</i>
Time 13:44:00	<i>Time of 1st Output</i>
Seq QTY Net	
0001 P1 4999 10.00kg	<i>Accumulation No., platform No., quantity and net weight</i>
0002 P2 5000 10.00kg	
0005 PA 10000 20.00kg	

0005 PA	<i>Total accumulation No and platform No. of last output</i>
Total 19999 40.00kg	<i>Total accumulated quantity and weight.</i>

Appendix H: - Lab 5 Output Format

Transaction data is sent in journal output format with time and quantity of each individual transaction. Refer to below for details.

Lab 5 Output Format Illustration

Data Explanation

Name Customer Code	<i>Customer Code (if entered)</i>
Pcode Product Code	<i>Product Code (if entered)</i>
Opr 8888	<i>Operator Code (if entered)</i>
Mac 11	<i>Machine ID (if entered)</i>
MacGp 22	<i>Machine Group Number (if entered)</i>
Date 2018-08-19	<i>Date of 1st output</i>
Seq Time QTY	
0002 PA 14:09:07 10000	
0004 PA 14:09:15 10000	
0003 P1 14:09:25 4999	<i>Accumulation No., platform No., time and quantity</i>
0003 P2 14:09:29 5001	

0003 P2 Total: 15003	<i>Total accumulation No, platform No. of last output and total accumulated quantity</i>

Appendix I: - TSC Printer Installation, Setup & Label Upload Procedures

I.1 Get the below ready before Printer Installation

1. An appropriate cable to connect printer and computer. This cable usually comes with the printer. If not, contact your printer supplier.
2. Printer installation driver. This driver usually comes with the printer. If not, contact your printer supplier.
3. Diagnostic tool for printer. This tool usually comes with the printer. If not, contact your printer supplier or download it at: - https://www.fi-measurement.com/files/1/Drivers%20&%20Softwares/DiagTool_V163.zip
4. TCF file for the label printer. The suitable TCF file can be downloaded at: - www.fi-measurement.com/resource/driversnsoftwares



I.2 Printer Installation

1. Turn off the printer, connect the appropriate cable, and then turn on the printer.
2. If the printer supports Plug-and-Play, and you have connected it using a USB or Parallel cable, then the Windows Add Hardware Wizard will detect the printer and display a dialog that allows you to install a driver. Click Cancel and do not install the driver using this wizard.
3. Run the Driver Wizard utility from the Installation Directory where the driver files are located.
4. Select Install Printer Drivers and complete the wizard.
5. The driver should now be installed.

I.3 Uploading TCF File to Printer

In order to allow proper operation between this instrument and TSC label printer, a TCF file must be uploaded to printer.

1. Connect printer with computer.
2. Power on printer.
3. Download the correct TCF file point 4 of I.1.
4. Unzip the download file and save in to computer.
5. Run Diagnostic tool for printer.
6. Click on Command Tool.
7. Click on Send file.
8. Double click on the TCF file and it will be uploaded to printer.

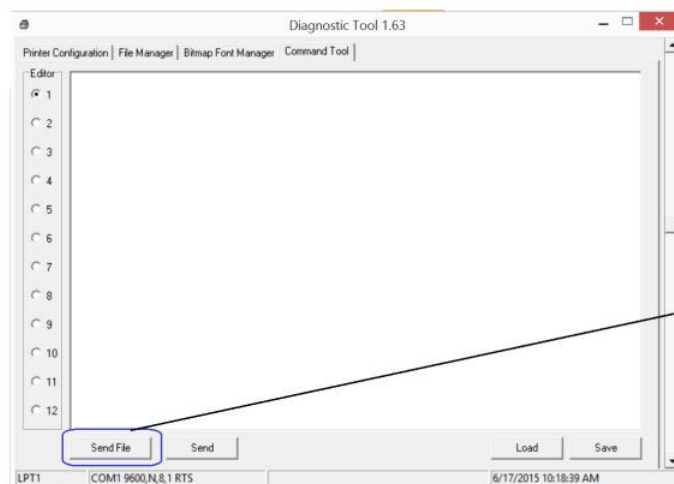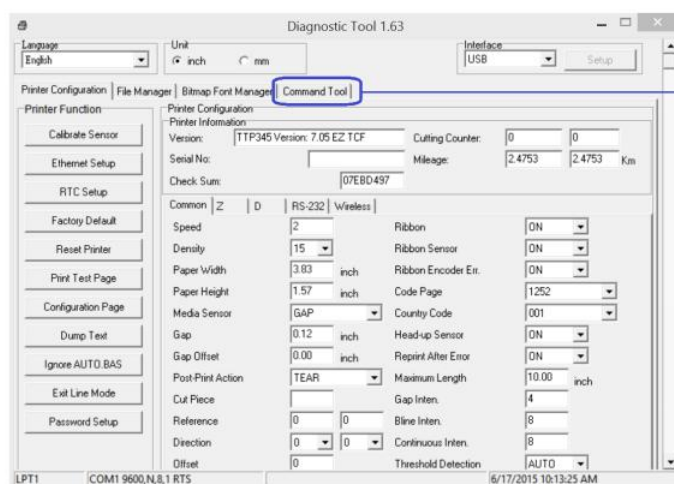

I.4 Create & Upload Label to TSC Printer


I.4.1 Selecting the Correct Edition for Bartender Software

1. To enable label uploading from computer to TSC printer, it is necessary to run Bartender as Automation or Enterprise Automation edition. Procedures as below: -
2. Install Bartender Software to computer. The Bartender software usually comes with the TSC printer. If not, please contact your printer supplier.
3. Run Bartender, then click on Help, then click on Edition Selection.
4. Select Enterprise Automation or Automation, then click OK.
5. At this point, correct Bartender edition is selected.



I.4.2 Adding Information from Instrument to Label & Uploading to a TSC Printer

The below procedures are based on Bartender Label Software. If a different label creating software is used, contact your label software dealer for more details if in doubt.

1. Set the label printer as the default printer of your computer.
2. Create the foundation of a label by Bartender. All information to be obtained from instrument should be added afterward.
3. Once the label foundation has been completed; (a) click on File and (b) select Export Printer Code Template.
4. On Print System; (a) select TSC KP-100/200 (Flash) and (b) select to Port.
5. Click More Option.
6. Then (a) click Print Dialog Data Sources, then (b) click on Format ID/Name.
7. On Template Field, select Template Field for Type.
8. Enter the correct label file name on Name/Value. Refer to paragraph 14.1 for correct file name format. (a) Click Copies, check KDU and (b) input asterisk (*) on Prompt box.
9. Below procedures explain how to edit information to be obtained from instrument.
10. Click Template Object Data Sources and Select the object which information from instrument (for example net, gross, tare weight and product code) to be sent to printer and printed on label.

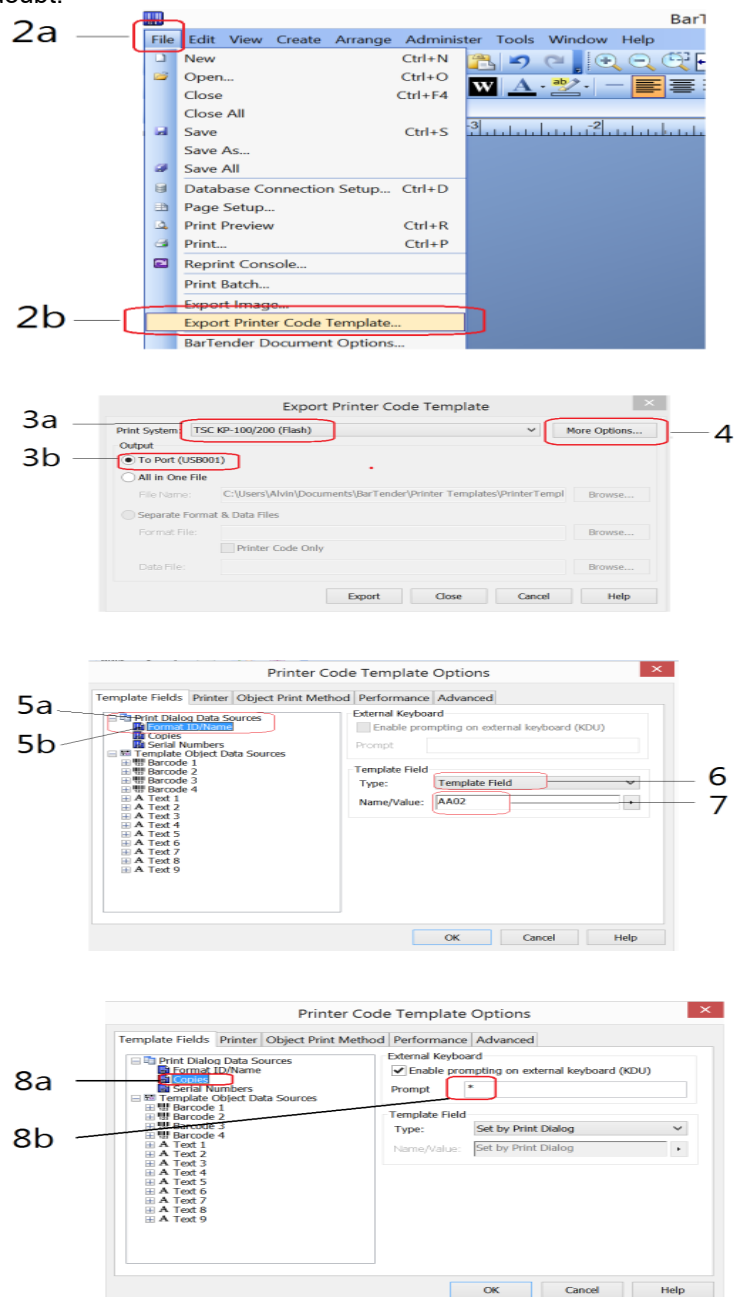

11. Double click on the preferred data source to which variant(s) has/have to add.
12. check the box below External Keyboard, then
13. enter the appropriate command on the Prompt Box (refer to paragraph **K.1** for command detail).
14. Select Auto on the Source box under Template Field.
15. Repeat point 11 to 12 for all other data sources.
16. Click OK.
17. Click Export. In case of Verification Messages appear, select one of method on the dialogue box to fix and click Continue.

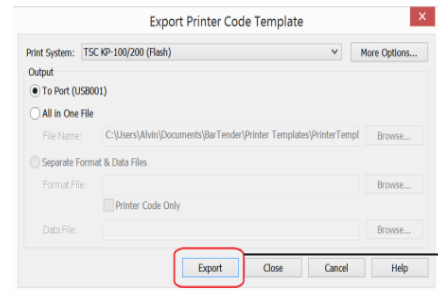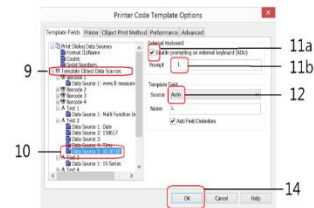

Appendix J: - Sbarco Printer Installation, Setup & Label Upload Procedures

J.1 Get the below ready before Printer Installation

1. An appropriate cable to connect printer and computer. This cable usually comes with the printer. If not, contact your printer supplier.
2. A serial cable to connect printer and this instrument. **Pin #9 of this cable must be without any connection.**
3. Download BarDrawer software at <http://www.sbarcotech.com/cht/download.php?gid=1>

J.2 BarDrawer Software & Printer Driver Installation

1. Turn off the printer, connect computer and printer by cable, and then turn on the printer.
2. Install BarDrawer software according to the wizard. After that BarDrawer software is installation is done.
3. Run BarDrawer software.
4. Click Install Driver under Tools (figure 1 below). Then install printer driver according to the wizard.
5. After printer driver installation, click Printer Utility under Tools (figure 2 below).
6. Click Load from Printer (figure 3 below).
7. Check FW version: -
 - If FW version = 3.0.05 (date = 2020/12/18) or newer, printer installation is done.
 - If FW version is lower than 3.0.05 (date = 2020/12/18), then FW update is necessary. Continue with below step for FW update.
8. Download the latest Sbarco Printer FW at <https://www.fi-measurement.com/resource/driversnsoftwares>
9. Open file located of the Sbarco printer FW downloaded.
10. Double click on the FW file name to start Firmware Tool.
11. Click Program (figure 4 below) to start FW update.
12. Click OK after FW update is completed.



Figure 1

 
 


Figure 2

Figure 3

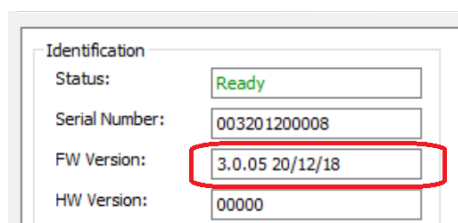


Figure 4


 



Figure 5

J.3 Create & Upload Label to Sbarco Printer


1. Run BarDrawer. Click File and then New.
2. On Printer Driver Selection page: -
 - a. click on the preferred printer driver, then
 - b. select Make Form under Type, then
 - a click Finished.
3. Double click in blank label area, then complete all settings on Page, Label Layout, Measurements and Orientation. Then click OK
4. Create all fixed content and variables on label.

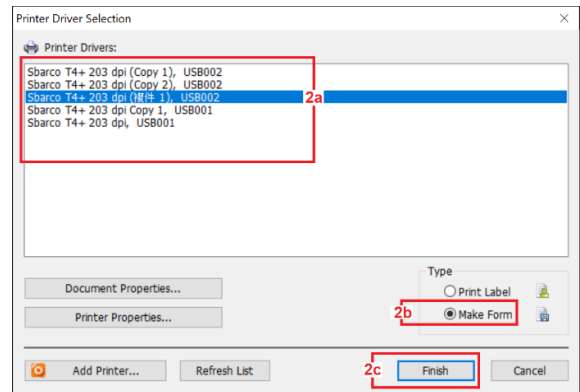


5. To program variables, double click on the variable to program. On Content page: -
 - a. On Sub-String section, select RS-232 Input for Source and give a proper name to the select variable (optional)
 - b. On Type section, select Single Variable,
 - c. On Format section, enter value of Maximum number of characters. Refer to **K.1** Suggested Length column for suggested value.
 - d. On Input Data section, select After send instructions (Hex). Then enter the Prompt Command listed on **K.1**.
 - e. Always select 0D,0A for Newline symbol (Hex) box.
 - f. Click OK to save above settings for this variable.
 - g. Repeat above a ~ f for all other variables.

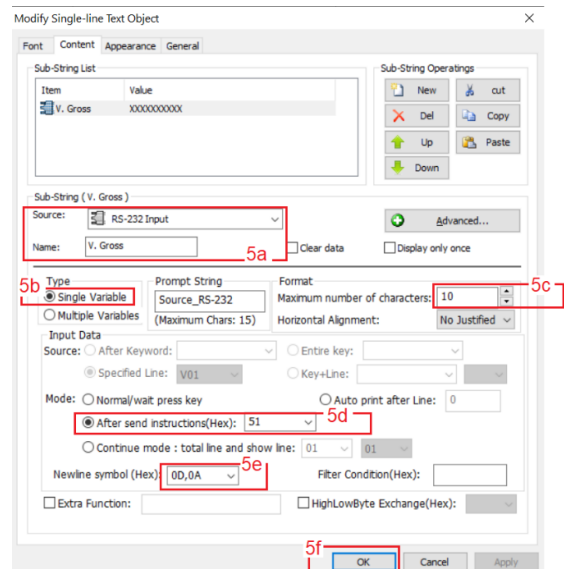

6. Once the label foundation has been completed, then click on File then click on Print. On Download Form page: -
 - a. select name of Print to output,
 - b. click Modify and then give proper name to the file (e.g. AA01... AA99 for individual transaction label and BB01...BB99 for totalized label).
 - c. always leave Print with Page Quantity box **unchecked**.
 - d. set all boxes under Device Settings,
 - e. set of boxes under Media Settings
 - f. Click Download.

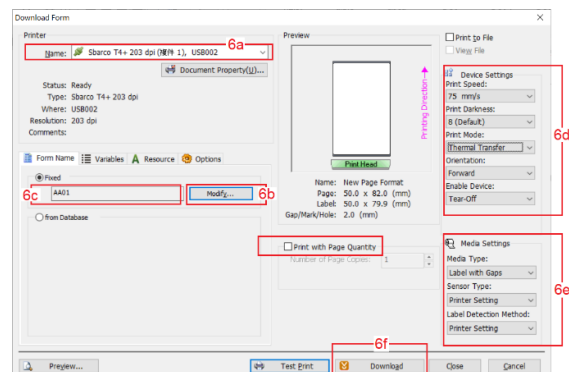

7. On Save Form page: -
 - a. make sure that the Form name is correct, then
 - b. Click Save
8. On Select Store Media page: -
 - a. select Printer, then
 - b. select Printer's Flash ROM, then
 - c. click OK

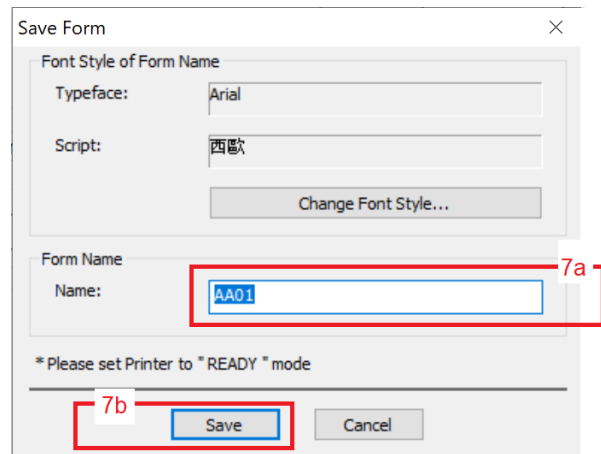

Save Form

Font Style of Form Name

Typeface: Arial

Script: 西歐


Change Font Style...

Form Name

Name: AA01

* Please set Printer to "READY" mode

Save Cancel

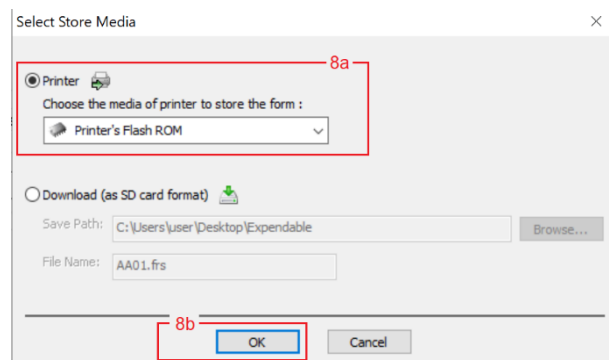

Select Store Media

☒ Printer

Choose the media of printer to store the form :

Printer's Flash ROM

☐ Download (as SD card format)

Save Path: C:\Users\user\Desktop\Expendable

File Name: AA01.frs

OK Cancel

Appendix K: - Label Programming, Illustration & Samples

Prompt commands, information description, working mode and suggested length on label are listed on the below table.


K.1 Label Prompt Command Table

Prompt Command		Description	Suggested Length
Sbarco	LP50 & TSC		
4B	DATE	Date	10
4C	TIME	Time	8
45	EXPY	Expiry Date	10
46	WEEK	Week	6
66	OPER	Operator No.	4
64	MCID	Machine ID	4
65	MCGP	Machine Group	2
5A	CCDE	Customer Code	18
43	CCDD	Customer Code Description	24
62	PCDE	Product Code	18
44	PCDD	Product Code Description	24
53	CHKL	Low Limit	11
73	chkl6	Low Limit in 6-digit integer	6
52	CHKH	High Limit	11
72	chkh6	High Limit in 6-digit integer	6
54	CHKR	Check Result	11
51	CWGS	Current Gross Weight	10
71	cwgs6	Current Gross Weight in 6-digit integer	6
50	CWTA	Current Tare Weight	10
70	cwta6	Current Tare Weight in 6-digit integer	6
4F	CWNT	Current Net Weight	10


6F	cwnt6	Current Net Weight in 6-digit integer	6
55	CQTY	Quantity	11
75	cqty6	Quantity in 6-digit integer	6
56	AVGW	Unit Weight	10
76	avgw6	Unit Weight in 6-digit integer	6
59	CWNT	Current Animal Weight	11
79	cwnt6	Current Animal Weight in 6-digit integer	6
4D	ASEQ	Accumulation Sequence No.	8
6D	aseq6	Accumulation Sequence No. in 6-digit integer	6
47	AWGS	Accumulated Gross Weight	11
67	awgs6	Accumulated Gross Weight in 6-digit integer	6
4A	AWTA	Accumulated Tare Weight	11
6A	awta6	Accumulated Tare Weight in 6-digit integer	6
4E	AWNT	Accumulated Net Weight	11
6E	awnt6	Accumulated Net Weight in 6-digit integer	6
63	AQTY	Accumulated Quantity	11
69	aqty6	Accumulated Quantity in 6-digit integer	6
4E	AWNT	Accumulated Animal Weight	11
6E	awnt6	Accumulated Animal Weight in 6-digit integer	6

K2. Label programming Illustration

K.2.1 Label Illustration for LP50 & TSC

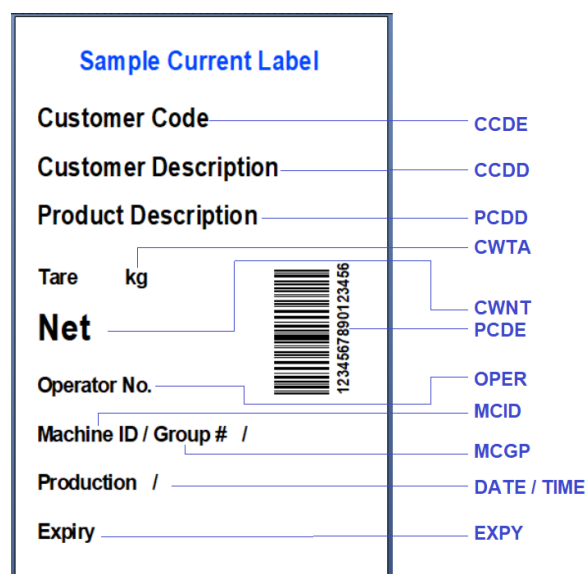

K.2.2 Label Illustration for Sbarco

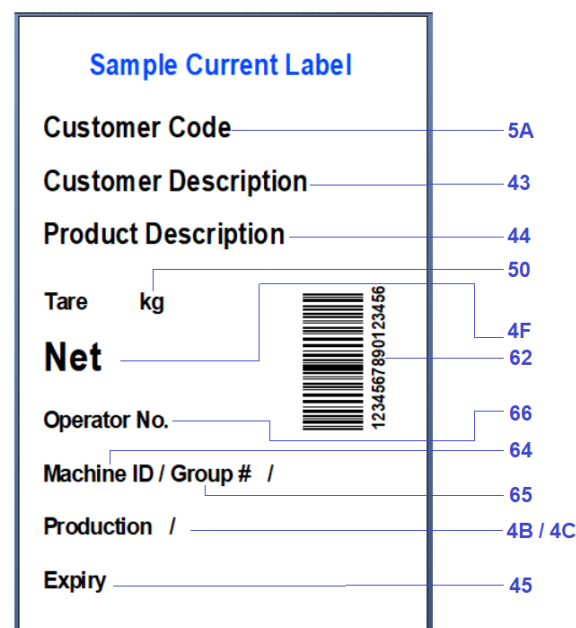

K.3 Sample Labels

Label files of the above samples (size = 50 x 80mm) with prompt commands are available for download at: - <https://www.fi-measurement.com/resource/driversnsoftwares>

K.4 Quick Access to Label Settings

If label printer (TSC or LP50) is selected, follow the below procedures to access quick label settings during operation.

1. Enter F1, then press **[Check]**,
2. Instrument displays number of copy to generate each time. Press **[PF/Set]** or **[MR]** until the preferred parameter appears then press **[Print/M+]** to save.
3. Instrument displays label file number (FL1 00 ~ FL1 99) to print in label format group 1. Enter the preferred file number through numeric then press **[Print/M+]** to confirm.
4. Instrument displays label file number (FL2 00 ~ FL2 99) to print in label format group 2. Enter the preferred file number through numeric then press **[Print/M+]** to confirm.
5. At this point, label settings are completed.

K.5 Repetitive Printout

This instrument supports repetitive output under Manual Print Mode. Press **[Print/M+]** for additional output copies.

Conditions and criteria as below: -

- When Auto Accumulation is set to On: Repetitive print is only possible when the actual weight on scale is equal to the weight value of the 1st printout.
- When Auto Accumulation is set to Off: Repetitive print is possible if minimum output weight set is matched and when **[Print/M+]** is pressed.
- Weight value of repetitive output will not change the total accumulation result. Only the weight value of the 1st output will be accumulated to memory.

Appendix L: - Keyboard Command

Keyboard command format as below: -


- Start String * "asterisk" (Hex code 02A), followed by
- Letters KB, followed by
- Letter shown on below illustration diagram (keyboard commands are case sensitive), followed by
- End String # "number sign" ((Hex code 23).

Example to send manual Zero key command to instrument, enter *KBA#

Notes: -

- For RS485 communication, add @xx before start string.
- xx = machine ID number set in F18.

Keyboard Command Illustration Diagram

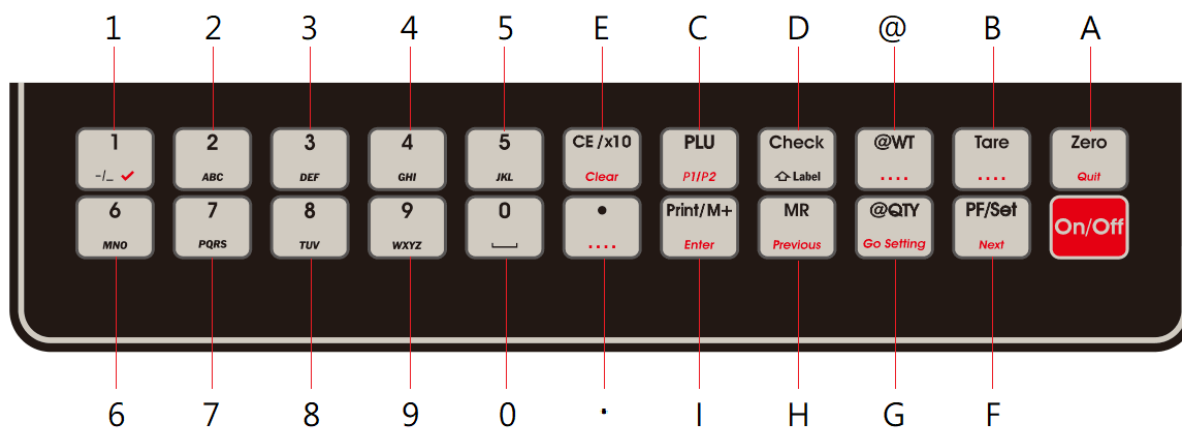

Appendix M: - Execution Commands

Execution command format as below: -

- a. Start String * "asterisk" (Hex code 02A), followed by
- b. Command code as shown on below table (all commands are case sensitive), followed by
- c. End String # "number sign" (Hex code 23).

Notes: -

- For RS485 communication, add @xx before start string.
- xx = machine ID number set in F18.

M.1 Command Description Table (System Related)

Command Definition	Command Format			
	Start String	Command Code		End String
System Reboot	*	EX	F000	#
All Segment Check	*	EX	F002	#
System (F7~F34) Initialization	*	EX	F006	#
Reset WIFI Module to Default Setting	*	EX	F048	#
Reset Bluetooth Module (BT 2.0 only)	*	EX	F053	#
Reload Factory Settings to BT Module (BT 2.0 only)	*	EX	F054	#
Save changes and restart	*	EX	F999	#

M.2 Command Description Table (Report Related)

Command Definition	Command Format			Parameter Description
	Start String	Command Code	Parameter & End String	
Output all data in alibi memory.	*	EX	RPTA ;d1;d2;d3;d4#	Search Criteria - d1 = Operator Code 0000~9999. Blank = all. - d2 = C Code. 1~18 digit Customer Code. Blank = all. - d3 = P Code. 1~18 digit Product Code. Blank = all. - d4 = Check Result. LO = Below; OK = Accept; HI = Above; NG = LO or HI. Blank = all.
Output data of today in alibi memory.	*	EX	RPTD ;d1;d2;d3;d4#	
Output data of current month in alibi memory.	*	EX	RPTM ;d1;d2;d3;d4#	
Output data of specific period in alibi memory.	*	EX	RPTP ;d1;d2;d3;d4;d5;d6#	Search Criteria - d1 = Data starting date. 6 digit according F4 setting. - d2 = Data ending date. 6 digit according F4 setting - d3 = Operator Code 0000~9999. Blank = all. - d4 = C Code. 1~18 digit Customer Code. Blank = all. - d5 = P Code. 1~18 digit Product Code. Blank = all. - d6 = Check Result. LO = Below; OK = Accept; HI = Above; NG = LO or HI. Blank = all.

M.3 Command Description Table (Customized Setting PLU Related)

Command Definition	Command Format			Parameter Description
	Start String	Command Code	Parameter & End String	
Execute customized Setting PLU saved for PF#1	*	E1	LP ;d1#	d1 = PLU number 00 ~ 99. 00 = quit all customized settings and return to instrument normal settings.
Execute customized Setting PLU saved for PF#2	*	E2	LP ;d1#	
Execute customized Setting PLU saved for #PA	*	EA	LP ;d1#	

Appendix N: - System Parameter & Operation Entry Setting Commands

System parameter & operation entry setting command format as below: -

- Start String * "asterisk" (Hex code 02A), followed by
- Command code as shown on below table (all commands are case sensitive), followed by
- Parameter(s) listed on below table. Always insert semi colon (;) in front of each parameter, followed by
- End String # "number sign" (Hex code 23).

Notes: -

- For RS485 communication, add @xx before start string.
- xx = machine ID number set in F18.

Command Description Table

Command Definition	Command Format			Parameter Description
	Start String	Command Code (Note A)	Parameter & End String	
Set Date Format, Value and Output	*	ST	F004 ;d1;d2;d3#	- d1 = Date Format (0 = DD-MM-YY, 1 = YY-MM-DD, 2 = MM-DD-YY) - d2 = 8-digit date value as per above setting (AA-BB-CC) - d3 = Date Output Format (0 = Normal Format, 1 = Week Format)
Set Time	*	ST	F005 ;d1#	8-digit time value (HH:MM:SS)
Set Auto Power Off	*	ST	F007 ;d1#	0 = Off, 1 = 1 minute, 2 = 3 minute, 3 = 5 minute 4 = 10 minute, 5 = 20 minute, HH:MM:SS = exact power off time
Set Brightness and Color Ratio	*	ST	F008 ;d1;d2#	- d1 = Brightness (01~99) - d2 = Color Ratio (01~99)
Set Totalization of Platform #1 & #2	*	ST	F009 ;d1#	0 = Off (disable) 1 = On (Enable)
Set Filter Strength & AD Conversion	*	ST	F010 ;d1;d2#	d1= Filter (1~9 for Filter 1~9)

Command Definition	Command Format			Parameter Description
	Start String	Command Code (Note A)	Parameter & End String	
Speed				d2 = AD Conversion Speed (015/030/060/120)
Set Auto Tare Function	*	ST	F012 ;d1#	M = Off, A = Auto, 00 ~ 99 = Continuous tare (in terms of 1/10 second)
Set Repetitive Tare Function	*	ST	F013 ;d1#	0 = Off, 1 = On
Set Buzzer	*	ST	F014 ;d1;d2;d3#	- d1 = Keyboard Buzzer (0 = Off, 1 = On) - d2 = System Buzzer (0 = Off, 1 = On) - d3 = Non-Resettable Memory Buzzer (0 = Off, 1 = On)
Set Result Buzzer & Action on Negative Value	*	ST	F015 ;d1;d2#	- d1 = Check Buzzer (0 = Off, 1 = IN, 2 = Out, 3 = Hi, 4 = Lo) - d2 = Action on Negative Value (0 = Off, 1 = On)
Set Keyboard Lock	*	ST	F020 ;d1#	0 = Off, 1 = On
Set Near Zero Value	*	S1 or S2	F026 ;d1#	Maximum 8 digits including decimal (if any)
Set Ask for Operator Number when Power On	*	ST	F028 ;d1#	0 = No, 1 = Yes
Set Allow Letters and Symbols for Customer & Product Code Manual Entry	*	ST	F030 ;d1#	0 = No, 1 = Yes
Set PF/Set Key Assignment	*	ST	F031 ;d1#	0 = Set, 1 = Platform
Set External Input Assignment	*	ST	F032 ;d1;d2;d3#	- d1 = Int 1 (0~5) - d2 = Int 2 (0~5) - d3 = Int 3 (0~5) 0 = Zero, 1 = Tare, 2 = PF/Set; 3 = Print/M+, 4 = MR, 5 = Clear
Set Report Output Comport	*	ST	F033 ;d1#	0 = Uart 0, 1 = Uart 1, 2 = Uart 2, 3 = Uart 3

Command Definition	Command Format			Parameter Description
	Start String	Command Code (Note A)	Parameter & End String	
Set Average Piece Weight before Power Off	*	ST	F035	;d1# 0 = Off, 1 = On
Set Customer Code and Description	*	ST	CCDE	;d1;d2# - d1 = Customer Code. Maximum 18 characteristics. Asterisk (*), number sign (#) and semi colon not accepted. Blank = Nothing - d2 = Customer description. Maximum 24 characteristics. Asterisk (*), number sign (#) and semi colon not accepted. Blank = Nothing
Set Product Code and Description	*	ST	PCDE	;d1;d2# - d1 = Product Code. Maximum 18 characteristics. Asterisk (*), number sign (#) and semi colon not accepted. Blank = Nothing - d2 = Product description. Maximum 24 characteristics. Asterisk (*), number sign (#) and semi colon not accepted. Blank = Nothing
Set Weight Check Limits	*	S1 or S2	CHKW	;d1;d2# - d1= Lo limit. Maximum 6 digit plus decimal (if any). - d2 = Hi limit. Maximum 6 digit plus decimal (if any).
Set Quantity Check Limits	*	S1 or S2	CHKQ	;d1;d2# - d1= Lo limit. Maximum 6 digit. Decimal not accepted. Blank = nothing - d2 = Hi limit. Maximum 6 digit. Decimal not accepted. Blank = nothing
Set Pre-set Tare Value (Note B)	*	S1 or S2	PSTA	;d1# Maximum 6 digit plus decimal (if any).
Set @WT	*	ST	AVGW	;d1# Maximum 6 digit plus decimal (if any). Blank = 0
Set Expiry Duration	*	ST	EXPY	;d1# 4 digits. 0000 = today, 9999 = 9999 days plus today

Note A: -

- S1 = command to set parameter for PF#1.
- S2 = command to set parameter for PF#2.
- ST = command to set parameter for #PA.

Note B: - If old preset tare value already exists in memory, 2 command strings are necessary: -

- a. 1st command string to clear this old preset tare value first.
- b. 2nd command string to set new preset tare value.

Appendix O: - System Parameter Reading Commands

System parameter reading command format as below: -

- Start String * "asterisk" (Hex code 02A), followed by
- Command code as shown on below table (all commands are case sensitive), followed by
- End String # "number sign" (Hex code 23).

Notes: -

- For RS485 communication, add @xx before start string.
- xx = machine ID number set in F18.

Refer to below table for content of output. A semi colon is inserted between parameters.

Command Description Table

Command Definition	Command Format			Parameter Output	Parameter Description
	Start String	Command Code	End String		
Read Internal AD value	*	R1 or R2	F001	#	d1 8 digits AD value
Read Capacity, Division & Default Weight Unit	*	R1 or R2	F003	#	d1;d2 - d1 = Capacity x Division of MAX1 - d2 = Capacity x Division of MAX2 (if set)
Read Date Format, Value and Output Settings	*	RD	F004	#	d1:d2;d3 - d1 = Date Format (0 = DD-MM-YY, 1 = YY-MM-DD, 2 = MM-DD-YY) - d2 = 8-digit date value as per above setting (AA-BB-CC) - d3 = Date Output Format (0 = Normal Format, 1 = Week Format)
Read Time	*	RD	F005	#	d1 8-digit time value (HH:MM:SS)
Read Auto Power Off	*	RD	F007	#	d1 0 = Off, 1 = 1 minute, 2 = 3 minute, 3 = 5 minute, 4 = 10 minute, 5 = 20 minute, HH:MM:SS

Command Definition	Command Format			Parameter Output	Parameter Description
	Start String	Command Code	End String		
					= exact power off time
Read Brightness and Color Ratio	*	RD	F008	#	d1;d2 - d1 = Brightness (01~99) - d2 = Color Ratio (01~99)
Read Totalization of Platform #1 & #2	*	RD	F009	#	d1 0 = Off (disable) 1 = On (Enable)
Read Filter Strength & AD Conversion Speed	*	RD	F010	#	d1;d2 - d1 = Filter (1~9 for Filter 1~9) - d2 = AD Conversion Speed (015/030/060/120)
Read Auto Tare Function	*	RD	F012	#	d1 M = Off, A = Auto, 00 ~ 99 = Continuous tare (in terms of 1/10 second)
Read Repetitive Tare Function	*	RD	F013	#	d1 0 = Off, 1 = On
Read Buzzer	*	RD	F014	#	d1;d2;d3 - d1 = Keyboard Buzzer (0 = Off, 1 = On) - d2 = System Buzzer (0 = Off, 1 = On) - d3 = Non-Resettable Memory Buzzer (0 = Off, 1 = On)
Read Result Buzzer & Action on Negative Value	*	RD	F015	#	d1;d2 - d1 = Check Buzzer (0 = Off, 1 = IN, 2 = Out, 3 = Hi, 4 = Lo) - d2 = System Buzzer (0 = Off, 1 = On)
Read Keyboard Lock	*	RD	F020	#	d1 0 = Off, 1 = On
Read Near Zero Value	*	R0 or R1 or R2	F026	#	d1 Maximum 8 digits including decimal (if any)
Read Ask for Operator Number when Power On	*	RD	F028	#	d1 0 = No, 1 = Yes

Command Definition	Command Format			Parameter Output	Parameter Description
	Start String	Command Code	End String		
Read Calibration & Parameter Counts and Pointer Value	*	RD	F029	#	d1;d2;d3 - d1= Calibration Count - d2 = Parameter Set Count - d3 = Pointer Value
Read Allow Letters and Symbols for Customer & Product Code Manual Entry	*	RD	F030	#	d1 0 = No, 1 = Yes
Read PF/Set Key Assignment	*	RD	F031	#	d1 0 = Set, 1 = Platform
Read External Input Assignment	*	RD	F032	#	d1;d2;d3 - d1= Int 1 (0~5) - d2 = Int 2 (0~5) - d3 = Int 3 (0~5) 0 = Zero, 1 = Tare, 2 = Mode; 3 = Print/M+, 4 = MR, 5 = Clear
Read Report Output Comport	*	RD	F033	#	d1 0 = Uart 0, 1 = Uart 1, 2 = Uart 2, 3 = Uart 3
Read Average Piece Weight before Power Off	*	RD	F035	#	d1 0 = Off, 1 = On

Note C: -

- R1 = command to read parameter for PF#1.
- R2 = command to read parameter for PF#2.
- RD = command to read parameter which is common for both PF#1 and PF#2.

Appendix P: - Operation Entry Reading Commands

Operation entry reading command format as below: -

- Start String * "asterisk" (Hex code 02A), followed by
- Command code as shown on below table (all commands are case sensitive), followed by
- End String # "number sign" (Hex code 23).

Notes: -

- For RS485 communication, add @xx before start string.
- xx = machine ID number set in F18.

Command Description Table

Command Definition	Command Format			Parameter Output	Parameter Description
	Start String	Command Code	End String		
Read Customer Code	*	RD CCDE	#	d1	1~18-digit Customer Code. Blank = nothing
Read Customer Code Description	*	RD CCDD	#	d1	1~24 Customer Code Adscription. Blank = nothing
Read Product Code	*	RD PCDE	#	d1	1~18-digit Product Code. Blank = nothing
Read Product Code Description	*	RD PCDD	#	d1	1~24 Product Code Description. Blank = nothing
Read Machine ID	*	RD MCID	#	d1	2-digit Machine ID Number. Blank = nothing
Read Machine Group	*	RD MCGP	#	d1	2-digit Machine Group Number. Blank = nothing
Read Operator No.	*	RD OPER	#	d1	4-digit Operator Number. Blank = nothing
Read @WT	*	RD AVGW	#	d1	Maximum 9 digit including decimal.
Read @WT unit	*	RD AVGU	#	d1	(space)g = gram, lb = 1/1000 lb

Command Definition	Command Format			Parameter Output	Parameter Description	
	Start String	Command Code	End String			
Read Date Value	*	RD	DATE	#	d1	8-digit date value
Read Expiry Duration	*	RD	F036	#	d1	0 ~ 9999 (Day)
Read Time Value	*	RD	TIME	#	d1	8-digit time value
Read Week Value	*	RD	WEEK	#	d1	6-digit time value
Read Expiry Date	*	RD	EXPY	#	d1	8 digits. Format as per F4 setting
Read @WT in 6-digit format and without decimal	*	RD	avgw6	#	d1	6 digits without decimal

Appendix Q: - Operation Result Reading Commands

Operation result reading command format as below: -

- Start String * "asterisk" (Hex code 02A), followed by
- Command code as shown on below table (all commands are case sensitive), followed by
- End String # "number sign" (Hex code 23).

Notes: -

- For RS485 communication, add @xx before start string.
- xx = machine ID number set in F18.

Command Description Table

Command Definition	Command Format				Parameter Output	Parameter Description
	Start String	Command Code (Note D)		End String		
Read Current Tare Weight	*	R0 or R1 or R2 or RA	CWTA	#	d1	8 digits including decimal
Read Current Gross Weight	*	R0 or R1 or R2 or RA	CWGS	#	d1	8 digits including decimal (if any)
Read Current Net Weight	*	R0 or R1 or R2 or RA	CWNT	#	d1	8 digits including decimal (if any)
Read Weight Unit of Current Net, Tare and Gross Weight	*	R0 or R1 or R2 or RA	CWUN	#	d1	8 digits including decimal (if any)
Read Qty Value	*	R0 or R1 or R2 or RA	CQTY	#	d1	8 digits
Read Low Limit	*	R0 or R1 or R2 or RA	CHKL	#	d1	8 digits including decimal (if any)
Read High Limit	*	R0 or R1 or R2 or RA	CHKH	#	d1	8 digits including decimal (if any)
Read Check Target	*	R0 or R1 or R2 or RA	CHKT	#	d1	kg = kilogram, (space)g = gram, pcs = quantity
Read Check Result	*	R0 or R1 or R2 or RA	CHKR	#	d1	Below/Accept/Above

Command Definition	Command Format			Parameter Output	Parameter Description
	Start String	Command Code (Note D)	End String		
Read Accumulated Gross Weight	*	R0 or R1 or R2 or RA	AWGS	#	d1 8 digits including decimal (if any)
Read Accumulated Tare Weight	*	R0 or R1 or R2 or RA	AWTA	#	d1 8 digits including decimal (if any)
Read Accumulated Net Weight	*	R0 or R1 or R2 or RA	AWNT	#	d1 8 digits including decimal (if any)
Read Weight Unit of Accumulated Net, Tare and Gross Weight	*	R0 or R1 or R2 or RA	AWUN	#	d1 8 digits including decimal (if any)
Read Accumulated Qty Value	*	R0 or R1 or R2 or RA	AQTY	#	d1 8 digits
Read Accumulation sequence No.	*	R0 or R1 or R2 or RA	ASEQ	#	d1 6 digits
Read Current Tare Weight in 6-digit format and without decimal	*	R0 or R1 or R2 or RA	cwta6	#	d1 6 digits without decimal
Read Current Gross Weight in 6-digit format and without decimal	*	R0 or R1 or R2 or RA	cwgs6	#	d1 6 digits without decimal
Read Current Net Weight in 6-digit format and without decimal	*	R0 or R1 or R2 or RA	cwnt6	#	d1 6 digits without decimal
Read Qty Value in 6-digit format and without decimal	*	R0 or R1 or R2 or RA	cqty6	#	d1 6 digits without decimal
Read Low Limit in 6-digit format and without decimal	*	R0 or R1 or R2 or RA	chkl6	#	d1 6 digits without decimal
Read High Limit in 6-digit format and without decimal	*	R0 or R1 or R2 or RA	chkh6	#	d1 6 digits without decimal
Read Accumulated Gross Weight in 6-digit format and without decimal	*	R0 or R1 or R2 or RA	awgs6	#	d1 6 digit without decimal
Read Accumulated Tare Weight in 6-digit format and without decimal	*	R0 or R1 or R2 or RA	awta6	#	d1 6 digit without decimal

Command Definition	Command Format				Parameter Output	Parameter Description
	Start String	Command Code (Note D)		End String		
Read Accumulated Net Weight in 6-digit format and without decimal	*	R0 or R1 or R2 or RA	awnt6	#	d1	6 digit without decimal
Read Accumulated Qty Value in 6-digit format and without decimal	*	R0 or R1 or R2 or RA	aqty6	#	d1	6 digit without decimal
Read Accumulation sequence No	*	R0 or R1 or R2 or RA	aseq6	#	d1	6 digit without decimal

Note D: -

- R0 = command to read entries and result of current platform in used.
- R1 = command to read entries and result of PF#1.
- R2= command to read entries and result of PF#2.
- RA = to read the totalized result of #PA.

Appendix R: - Quick PLU Saving Commands

Quick PLU saving command format as below: -

- Start String * "asterisk" (Hex code 02A), followed by
- Command code as shown on below table (all commands are case sensitive), followed by
- Parameters listed on below table. Always insert semi colon (;) in front of each parameter, followed by
- End String # "number sign" (Hex code 23).

Notes: -

- For RS485 communication, add @xx before start string.
- xx = machine ID number set in F18.

Command Description Table

Command Definition	Command Format					Parameter Description
	Start String	Command Code (Note E)			Parameter & End String	
Save Preset Tare to Quick PLU	*	S1/S2	QP	PSTA	;d1;d2#	- d1 = Quick PLU number 0~9. - d2 = Maximum 6 digits plus decimal.
Save Unit Weight (in terms of g) to Quick PLU	*	ST	QP	AVGW	;d1;d2#	- d1 = Quick PLU number 0~9 - d2 = Maximum 6 digits plus decimal.
Save Check WT Limits to Quick PLU	*	ST/S1/S2	QP	CHKW	;d1;d2;d3#	- d1 = Quick PLU number 0~9. - d2 = Low check limit. Maximum 6 digits plus decimal. - d3 = Hi check limit. Maximum 6 digits plus decimal.
Save Check QTY Limits to Quick PLU	*	ST/S1/S2	QP	CHKQ	;d1;d2;d3#	- d1 = Quick PLU number 0~9. - d2 = Low check limit. Maximum 6 digits. - d3 = Hi check limit. Maximum 6 digits.

Command Definition	Command Format			Parameter Description
	Start String	Command Code (Note E)	Parameter & End String	
Save Customer Code and Description to Quick PLU	*	ST	QP CCDE ;d1;d2;d3#	- d1 = Quick PLU number 01 ~ 99 - d2 = Customer Code. 1~18-digit . Maximum 24 characteristics Asterisk (*), number sign (#) and semi colon not accepted. Blank = Nothing. - d3 = Customer Description. Asterisk (*), number sign (#) and semi colon not accepted. Blank = Nothing.
Save Product Code and Description to Quick PLU	*	ST	QP PCDE ;d1;d2;d3#	- d1 = Quick PLU number 01 ~ 99 - d2 =Product Code. 1~18-digit Asterisk (*), number sign (#) and semi colon not accepted. Blank = Nothing. - d3 = Product Description. Maximum 24 characteristics Asterisk (*), number sign (#) and semi colon not accepted. Blank = Nothing.

Note E: -

- S1 = command to set parameter to Quick PLU of PF#1.
- S2 = command to set parameter to Quick PLU of PF#2.
- ST = command to set parameter to Quick PLU which is common for both PF#1 and PF#2.

Appendix S - Quick PLU Reading Commands

Quick PLU reading command format as below: -

- Start String * "asterisk" (Hex code 02A), followed by
- Command code as shown on below table (all commands are case sensitive), followed by
- End String # "number sign" (Hex code 23).

Notes: -

- For RS485 communication, add @xx before start string.
- xx = machine ID number set in F18.

Command Description Table

Command Definition	Command Format				Parameter & End String	Parameter Output	Parameter Description
	Start String	Command Code (Note F)					
Read Preset Tare from Quick PLU	*	R1/R2	QP	PSTA	;0~;9 or ;A (0~9 = PLU number. A = all)	d1	Maximum 8 digits plus decimal.
Read Unit Weight (in terms of g) from Quick PLU	*	RD	QP	AVGW		d1	Maximum 8 digits plus decimal
Read Check WT Limits from Quick PLU	*	RD/R1/R2	QP	CHKW		d1;d2	- d1 = Low check limit. - d2 = Hi check limit.
Read Check QTY Limits from Quick PLU	*	RD/R1/R2	QP	CHKQ		d1;d2	- d1 = Low check limit. - d2 = Hi check limit.
Read Customer Code and Description from Quick PLU	*	RD	QP	CCDE	;01~;99 or ;A (01~99 = PLU number. A = all)	d1;d2	- d1 = Customer Code. Blank = Nothing. - d2 = Customer Description. Blank = Nothing.
Read Product Code and Description from Quick PLU	*	RD	QP	PCDE		d1;d2	- d1 = Product Code. Blank = Nothing. - d2 = Product Description. Blank = Nothing.

Remark: If parameter A is entered, instrument sends content by Quick PLU numeric sequence.

Note F: -

- R1 = command to read content from Quick PLU of PF#1.
- R2 = command to read content from Quick PLU of PF#2.
- RD = command to read content from Quick PLU which is common for both PF#1 and PF#2.

Appendix T: - Customized Operation Settings PLU Saving Commands

Customized operation settings PLU saving commands format as below: -

- Start String * "asterisk" (Hex code 02A), followed by
- Command code as shown on below table (all commands are case sensitive), followed by
- Parameters listed on below table. Always insert semi colon (;) in front of each parameter, followed by
- End String # "number sign" (Hex code 23).

Notes: -

- For RS485 communication, add @xx before start string.
- xx = machine ID number set in F18.

T.1 Command Description Table

Start String	Command Code (Note G)		Parameter	End String
*	S1 or S2 or SA	LP	;d1;d2;d3;d4;d5;d6;d7;d8;d9;d10;d11;d12;d13	#

Note G: -

- S1 = command to set parameter for PF#1.
- S2 = command to set parameter for PF#2 .
- SA = command to set parameter for #PA.

T.2 Parameter Description Table

Parameter #		Description	Parameter
d1	PLU #		01 ~ 99
d2	Customer Code		Maximum 18 characteristics Asterisk (*), number sign (#) and semi colon not accepted. Blank = Nothing
d3	Customer Description		Maximum 24 characteristics Asterisk (*), number sign (#) and semi colon not accepted. Blank = Nothing
d4	Product Code		Maximum 18 characteristics Asterisk (*), number sign (#) and semi colon not accepted. Blank = Nothing
d5	Product Description		Maximum 24 characteristics Asterisk (*), number sign (#) and semi colon not accepted. Blank = Nothing
d6	Unit Weight In terms of g for metric version In terms of pound for lb version		Maximum 6 digit plus decimal. Blank = 0
d7	Low Check limit		When Check Target is = W: - Maximum 6 digit plus decimal. Blank = 0 When Check Target is = Q: - Maximum 6 digit. Blank = 0
d8	Hi Check limit		When Check Target is = W: - Maximum 6 digit plus decimal. Blank = 0 When Check Target is = Q: - Maximum 6 digit. Blank = 0
d9	Check Target		W = Weight Q = PCS Blank = PCS
d10	Auto Tare Type		M = Manual tare A = auto tare 00 ~ 99 = Continuous tare in terms of 1/10 second Blank = current instrument setting.

Parameter #	Description	Parameter
d11	Preset Tare Value	Maximum 6 digit plus decimal (if any). Blank = 0. If Platform # is = PA; enter zero value here.
d12	Date Format	0 = Normal 1 = Week
d13	Expiry Duration	Maximum 4 digits (0 ~ 9999) 0 or blank = F4 value 1 ~ 9999 = No. of day plus F4 value

Appendix U: Customized Operation Settings PLU Reading Commands

Customized operation settings PLU reading commands format as below: -

- Start String * "asterisk" (Hex code 02A), then followed by
- Command string listed on below table, then followed by
- Parameters listed on below table. Always insert semi colon (;) in front of each parameter, followed by
- End String # "number sign" ((Hex code 23).

Notes: -

- For RS485 communication, add @xx before start string.
- xx = machine ID number set in F18.

U.1 Command Description Table

Start String	Command Code (Note H)		Parameter & End String	Parameter Output
*	R1 or R2 or RA	LP	;01~;99 or ;A (01~99 = PLU number. A = all)	d1;d2;d3... ;d14

Remark: If parameter A is entered, instrument sends content of quick from PLU 01 to PLU 99 in numeric sequent.

Note H: -

- R1 = command to read PLU content of PF#1.
- R2= command to read PLU content of PF#2.
- RA = command to read PLU content of #PA.

Refer to below table for content of output. A semi colon is inserted between parameters.

U.2 Parameter Output Description Table

Parameter #	Parameter Output	Parameter Description
d1	Platform #	P1 = Platform #1 P2 = Platform #2 PA = Platform #1 + Platform #2
d2	PLU #	01 ~ 99
d3	Customer Code	1~18-digit (* or and # will not be accepted). Blank = Nothing
d4	Customer Description	Maximum 24 characteristics (* and # will not be accepted). Blank = Nothing
d5	Product Code	1~18-digit (* or and # will not be accepted). Blank = Nothing
d6	Product Description	Maximum 24 characteristics (* and # will not be accepted). Blank = Nothing
d7	Unit Weight (in terms of g)	Maximum 8 digits including decimal. Blank = Nothing
d8	Low Check limit	Maximum 8 digits including decimal. Blank = Nothing
d9	Hi Check limit	Maximum 8 digits including decimal. Blank = Nothing
d10	Check Target	W = Weight Q = PCS
d11	Auto Tare Type	0 = Manual; 1 = Auto Tare; 2 = Continuous Tare
d12	Preset Tare Value	Maximum 8 digits including decimal. Blank = Nothing If Platform # is = PA; then enter zero value here.
d13	Date Format	0 = Normal; 1 = Week
d14	Expiry Duration	Maximum 4 digits (0 ~ 9999) 0 = F4 value; 1 ~ 9999 = No. of day plus F4 value



Fidelity Measurement Company Limited

 www.fm.com.tw

 info@fm.com.tw